

Smart Transmitter/Gas Detector Head SD-1D-AS

(TYPE GP H)

(TYPE NC H)

Operating Manual

(PT2E-161)

(PT2-161)

RIKEN KEIKI Co., Ltd.

2-7-6 Azusawa, Itabashi-ku, Tokyo, 174-8744, Japan

Phone: +81-3-3966-1113 Fax: +81-3-3558-9110

E-mail: intdept@rikenkeiki.co.jp Web site: https://www.rikenkeiki.co.jp/

Operating Precautions

This detector is a gas detector that detects combustible gases in the air and triggers a gas alarm. The gas detector is a safety unit, not an analyzer or densitometer which performs quantitative/qualitative analysis/measurement for gases.

Please fully understand the following points before using it, so that it can be used properly.

- 1. This detector may be interfered by gases and vapors other than the gas to be detected. Please note that the alarm may be triggered by interference. In addition, it may be fluctuated by environmental (temperature, humidity, etc.) changes in the installation site.
- 2. The alarm must be set within a range where the performance of the detector can be ensured. In facilities compliant with the High Pressure Gas Safety Act, an alarm setting below our standard alarm setpoint may trigger a false alarm.
- 3. If use in safety unit, the analog signal output of the detector must be used for an indicator or external recorder.
 - If these outputs are used to control other units, we shall not be responsible for any malfunctions.
- 4. The gas sensing part of the gas detection sensor installed in this detector is made of metal porous sintered alloy permeated with an oxidation catalyst.
 If silicon or sulfide compounds are accumulated on the surface of porous sintered alloy, the area of the gas sensing part becomes smaller, which may results in serious deterioration of its sensitivity.
 For safety reasons, do not use the detector under the presence of silicon or sulfide compounds even though their amount is very small.
- 5. For maintenance of the detector, it must go through a regular maintenance, including replacement and adjustment of the regular replacement parts as specified in the operating manual.

<Contents>

1 Outline of the Product	
1-2. Purpose of use	
1-4. Method of confirmation for Standards and Explosion proof specification	. 3
2 Important Notices on Safety	.4 .5 .6
3 Product Components	. 9 . 9 . 11
4 How to Use	. 15 . 16 . 18 . 19 . 21
5 How to Operate 5-1. Preparation for start-up 5-2. Basic operating procedures 5-3. How to start the detector 5-4. Modes 5-5. Maintenance mode (User) 5-6. Flow Rate Adjustment 5-7. How to exit	. 26 . 27 . 28 . 29 . 30 . 33
6 Operations and Functions 6-1. Gas alarm activation 6-2. Fault alarm activation 6-3. External output operation 6-4. Other functions	. 34 . 35 . 36
7 Maintenance	. 38 . 40 . 49
8 Storage, Relocation and Disposal	. 54 . 54
9 Troubleshooting	. 55
10 Product Specifications	. 57 . 64
11 Definition of Terms	65

1 Outline of the Product 1-1. Preface

1

Outline of the Product

1-1. Preface

Thank you for choosing our smart transmitter/gas detector head SD-1D-AS(TYPE GP H)(TYPE NC H). Please check that the model number of the product you purchased is included in the specifications on this manual.

This manual explains how to use the detector and its specifications. It contains information required for using the detector properly. Not only the first-time users but also the users who have already used the product must read and understand the operating manual to enhance the knowledge and experience before using the detector.

The detector has two types of TYPE GP H and TYPE NC H. In this manual, instructions of TYPE GP H (such as an example of LED display) are described as example.

1-2. Purpose of use

The detector is a fixed type gas detector head that detects leak of combustible gases and that performs
the alarm activation when the gas concentration is over the setting value.
 This detector is a safety unit, not an analyzer or densitometer which performs quantitative/qualitative

analysis/measurement for gases. Please fully understand the features of the detector before using it,

so that it can be used properly.


- The detector detects abnormalities in the air caused by presence of gases or other reasons (leak) with the built-in gas sensor. The concentrations of detected gases are displayed on the seven-segment LED.
- The detector draws a gas by an aspirator using compressed air to perform gas detection.
- The detector outputs gas concentration in 4 20 mA.
- The detector has HART communication function.

1-3. Definition of DANGER, WARNING, CAUTION, and NOTE

DANGER	This message indicates that improper handling may cause serious damage on life, health or assets.
WARNING	This message indicates that improper handling may cause serious damage on health or assets.
CAUTION	This message indicates that improper handling may cause minor damage on health or assets.
NOTE	This message indicates advice on handling.

1-4. Method of confirmation for Standards and Explosion proof specification

This instrument has some specification depends on standard and explosion proof certificate. Please confirm the detector specification before using. Please refer Declaration of Conformity that is at the end of this manual if you have CE marking type. You can confirm instrument specification to see name plate as follows.

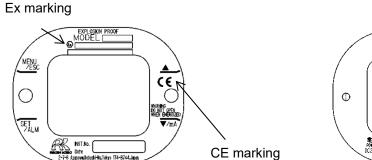

ATEX/IECEx, CE marking type name plate

TIIS certificate

EXCLUSION PROOF
EXCLUSION P

TIIS type name plate

2

Important Notices on Safety

2-1. Danger cases



DANGER

About explosion-proof

- The window plate material is a polycarbonate resin. Do not use organic solvents and alkali types (liquid or vapor). It may cause the color and shape of the window plate to be changed.
- Do not open the lid when applying current.
- Do not attempt to repair the detector.
- For the lid, use hexagon socket head bolts specified by RIKEN KEIKI.
- Do not apply a strong force or shock to the window plate. The explosion-proof performances
 may be deteriorated due to damages. The explosion protection conditions for the detector is
 "low (2J)" possibility of mechanical damage.
- Ambient temperature:
 - ATEX/IECEx Specifications: -20 to +60°C
 - TIIS Specifications: -20 to +53°C
- Do not replace parts at your sole discretion but contact RIKEN KEIKI if the transparent window
 has a crack or the explosion-proof joint surface is abnormal, or the clamping screw or bolt is
 changed, lost etc.
- Do not repair the explosion-proof joint surface.
- Be careful not to hit sharp tools against the window plate.

2-2. Warning cases



WARNING

Power supply

Before turning on the detector, always check that the voltage is properly applied. Do not use an unstable power supply because it may cause malfunctions.

Need of grounding circuit

Do not cut the grounding circuit or disconnect the wire from the grounding terminal.

Defects in protective functions

Before starting the detector, check the protective functions for defects. When seeming defects are found in the protective functions, such as protective grounding, do not start the detector.

External connection

Before connecting the detector to the external control circuit, securely connect it to a protective grounding circuit.

Tube

The detector is designed to draw gases around it under the atmospheric pressure. Be sure that excessive pressure is not applied to the sampling inlet and outlet (GAS IN, GAS OUT) of the detector. Detected gases must be exhausted from the detected gas exhausting outlet (GAS OUT) to which an exhaust tube is connected, to a point regarded as a safe place.

Zero adjustment in the atmosphere

When the zero adjustment is performed in the atmosphere, check the atmosphere for freshness before beginning the adjustment. If interference gases exist, the adjustment cannot be performed properly, thus leading to dangers when the gas leaks.

Response to gas alarm

Issuance of a gas alarm indicates that there are extreme dangers. Take proper actions based on your judgment.

2-3. Precautions



CAUTION

Do not use a transceiver near the detector.

Radio wave from a transceiver etc. near the detector or its cables may disturb indication reading. If a transceiver or other radio wave transmitting device is used, it must be used in a place where it disturbs nothing.

To restart the detector, wait for five seconds or more before doing it.

Restarting the detector in less than five seconds may cause errors.

Verify that the flow rate corresponds to the specified flow rate before using the detector.

If it does not correspond to the specified flow rate, gas detection cannot be performed properly. Check whether the flow rate is unstable or lost.

Attach the dust filter before using the detector.

Before using the detector, attach the specified filter to prevent disturbances by possible gas adsorption or air dust.

A dust filter to be used varies depending on the gas to be detected. For more information on dust filters, please contact RIKEN KEIKI.

Observe the operating restrictions to prevent condensation inside the tube.

Condensation formed inside the tube causes clogging or gas adsorption, which may disturb accurate gas detection. Thus, condensation must be avoided. In addition to the installation environment, carefully monitor the temperature/humidity of the sampling point to prevent condensation inside the tube. In particular, when detecting a gas which is dissolved into water and corrodes contacted materials, such as a strong acid gas, the gas is undetectable and furthermore may corrode internal parts. Please observe the operating restrictions.

Do not use the external output of the detector to control other units.

This is not a control unit. It is not allowed to use the external output of the detector to control other units.

Do not disassemble/modify the detector, or change the settings if not necessary.

Disassembling/modifying the detector will invalidate the warranty of the performance. Changing the settings without understanding the specifications may cause alarm malfunctions. Please use the detector properly in accordance with the operating manual.

Avoid applying organic solvents and others to the window plate for a long time.

The window plate material is a polycarbonate resin. When organic solvents (liquid or highly-concentrated vapor) and others are applied to the plate for a long time, its color and shape may be changed.

Never fail to perform a regular maintenance.

Since this is a safety unit, a regular maintenance must be performed to ensure safety. Continuing to use the detector without performing a maintenance will deteriorate the sensitivity of the sensor, thus resulting in inaccurate gas detection.

2-4. Safety information

Necessary information for explosion proof construction of Model SD-1D

The Model SD-1D is a fixed mount, continuous-monitoring detector head and provides a 4-20mA signal which indicates the target gas reading for use by a gas monitoring controller, recording device, or programmable controller.

<ATEX/IECEx Specifications>

Technical Data

(Protection Method) Flameproof enclosure "d"
(Certificate Numbers) IECEx KEM 10.0036X
KEMA 10ATEX0083 X

(Group) II (Category) 2G

(Type of Protection and Marking code) Ex db IIC T5

(Equipment Protection Level) Gb

(Ambient Temperature) -20°C to +60°C

(Electrical Data) Supply voltage: 24 V dc (Typ.)

Output signal: 4 to 20 mA


(Applicable Standard) IEC 60079-0: 2017, IEC 60079-1: 2014-06

EN IEC 60079-0: 2018, EN 60079-1: 2014

(Manual Number) PT2E-161

Installation

Installation Diagram

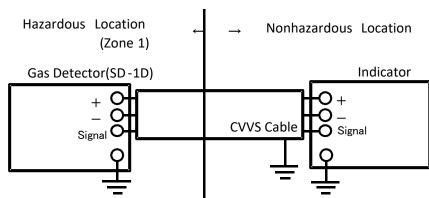

<TIIS Specifications>

Technical Data

(Protection Method) Flameproof enclosure

(Explosion-proof class) Ex d IIC T5 X (Ambient Temperature) -20° C to 53° C


(Electrical Data) Supply voltage: DC24V 125mA

Analog signal output: DC24V 25mA

(Applicable Standard) JNIOSH-TR-NO. 43(2008)

Installation

Installation Diagram

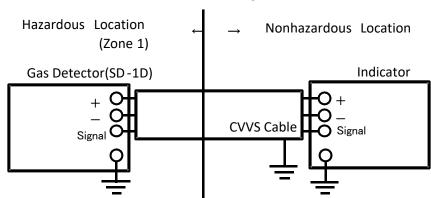



3

Product Components


3-1. Main unit and standard accessories


<Main Unit> (including a cable gland or an adapter)
[ATEX/IECEx Specification]

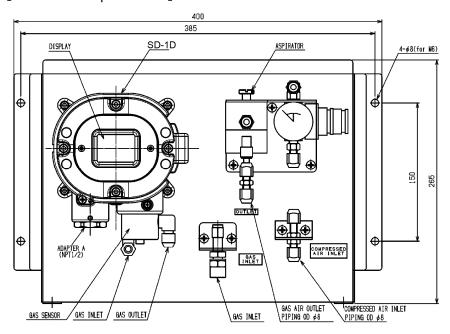

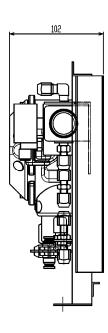

[TIIS Specification]

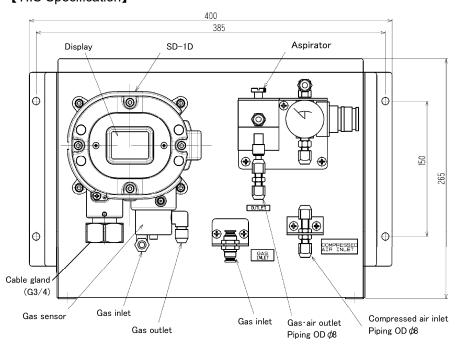

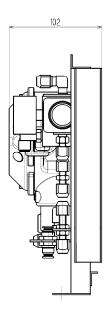

<Standard Accessories>

Operating manual ····· one
 Dedicated handling lever ··· one

• Dedicated control key The supplied quantity depends on the number of units to be delivered.

1 to 10 units	One
11 to 20 units	Two
21 to 50 units	Three
Over 51 units	Four

• MC filter with flow monitor ··· one



CAUTION


Use the supplied dedicated control key to operate the detector. If products other than these accessories are used, key operations cannot be accepted properly.

Note that the control key is made of extremely strong magnet. Putting it close to a magnetic product, such as a credit card and ID card, may damage the stored data.


NOTE:

This product is designed to have a gas detector head "SD-1D" incorporated in the sampling device. The internal tubing required for "SD-1D" has been arranged prior to shipment.

3-2. Names and functions for each part

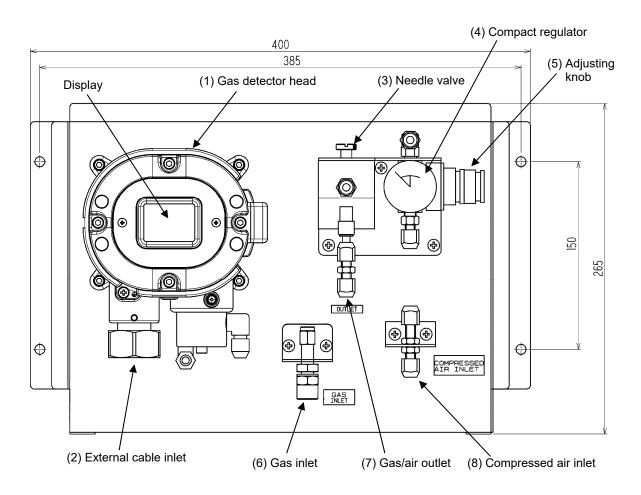


No.	Name	Function
(1)	Gas detector head	Detects a gas (applicable detector head: SD-1D).
(2)	External cable inlet	A port to draw a power and signal cables for the gas detector head.
(3)	Needle valve	Adjusts the amount of compressed air after reducing pressure.
(4)	Compact regulator	Reduces the pressure of supplied compressed air and displays a pressure value after the reduction.
(5)	Adjusting knob	A knob turned to reduce the pressure of supplied compressed air.
(6)	Gas inlet	An inlet for gases.
(7)	Gas/air outlet	An outlet for gases and compressed air.
(8)	Compressed air inlet	An inlet for compressed air.

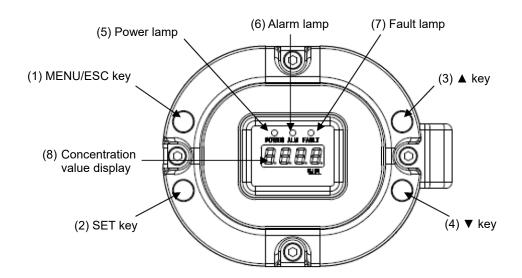


(1)	MENU/ESC key	Used to enter the maintenance mode. It is also used to cancel in a specific mode.
(0)	OFT!	·
(2)	SET key	It is used for value confirmation and so on in a specific mode.
(3)	▲ key	Used to switch menus or change a value (UP).
(4)	▼ key	Used to switch menus or change a value (DOWN).
(5)	Power lamp	Power lamp: Detection mode: It lights up in green. Maintenance mode: It blinks in green.
(6)	Alarm lamp	Alarm lamp. It lights up in red when the alarm setpoint value is reached.
(7)	Fault lamp	Fault lamp. It lights up in yellow when an abnormality is detected in the detector.
(8)	Concentration value display	Displays the gas concentration and so on.

3-3. Block diagram

<Electric Diagram>

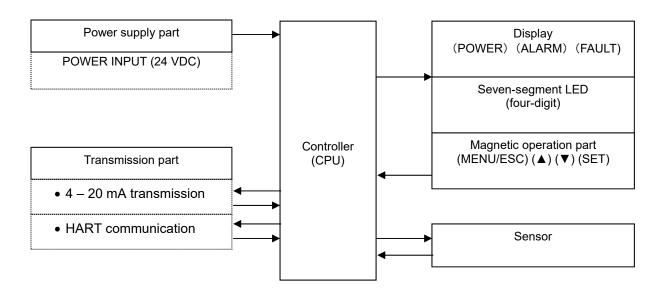

<Tubing Diagram>

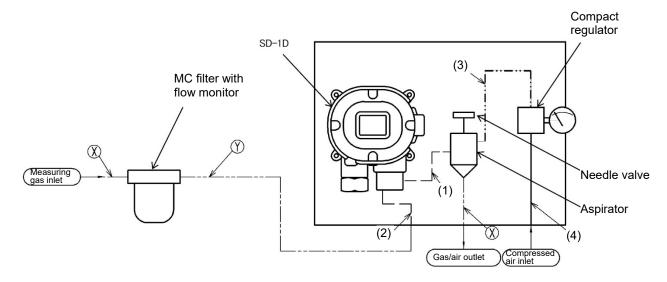

Bs (Brass) specification

* The	customer	is	re	quired	to	pro	ovide	the	Э	follo	W	ings	3.

— ... (Alternate long and two short dashed line) Copper or stainless tube (ø6 - ø8): X Copper or stainless tube (ø4 - ø6): Y

* Internal tubing has been arranged already.

- — — (Dashed line) Flexible tube: (1) Flexible tube: (2)

— . — (Alternate long and short dashed line) Copper tube (ø4 - ø6): (3)
— (Solid line) Copper tube (ø6 - ø8): (4)

SUS (Stainless) specification

* The customer is required to provide the followings.

— · · · · · · · · (Alternate long and two short dashed line) Stainless tube (ø6 - ø8): X Stainless tube (ø4 - ø6): Y

* Internal tubing has been arranged already.

____ (Dashed line) Flexible tube: (1) Flexible tube: (2)

— . — (Alternate long and short dashed line) Copper tube (ø4 - ø6): (3) Copper tube (ø6 - ø8): (4)

4

How to Use

4-1. Before using the detector

Not only the first-time users but also the users who have already used the product must follow the operating precautions.

Ignoring the precautions may damage the detector, resulting in inaccurate gas detection.

4-2. Precautions for installation sites



CAUTION

This is a precision device. Because the detector may not provide the specified performance in some places (environments), check the environment in the installation point, and then take appropriate actions if necessary.

Because the detector plays an important role for safety and disaster prevention, as many units of the detector as needed must be installed in appropriate points.

Because points where gases leak and remain easily are different depending on the types of gases and the working areas, please decide carefully on installation points and the number of units to be installed.

Do not install the detector in a place with vibrations or shocks.

The detector consists of sensitive electronic parts. The detector must be installed in a stable place without vibrations or shocks and it cannot drop.

Do not install the detector in a place exposed to water, oil or chemicals.

When selecting installation points, avoid a place where the detector is exposed to water, oil or chemicals.

Do not install the detector in a place where the range of operating temperatures is exceeded.

The detector must be installed in a stable place where the operating temperature is maintained and do not change suddenly.

<ATEX/IECEx Specifications> -20 to +60°C

<TIIS Specifications> -20 to +53°C

Do not install the detector in a place exposed to direct sunlight or sudden changes in the temperature. When selecting installation points, avoid a place where it is exposed to direct sunlight or radiant heat (infrared rays emitted from a high-temperature object), and where the temperature changes suddenly. Condensation may be formed inside the detector, or the detector cannot adjust to sudden changes in the temperature.

Keep the detector (and its cables) away from noise source devices.

When selecting installation points, avoid a place where high-frequency/high-voltage devices exist.

Do not install the detector in a place where maintenance of the detector cannot be performed or where handling the detector involves dangers.

Regular maintenance of the detector must be performed.

Do not install the detector in a place where the machinery must be stopped when maintenance is performed in its inside, where parts of the machinery must be removed to perform maintenance, or where the detector cannot be removed because tubes or racks prevent access to it. Do not install the detector in a place where maintenance involves dangers, for example, near a high-voltage cable.

Do not install the detector in machinery which is not properly grounded.

Before installing the detector in machinery, the machinery must be grounded properly.

Do not install the detector in a place where interference gases exist around it.

The detector must not be installed in a place where interference gases exist around it.

4-3. Precautions for system designing



CAUTION

An unstable power supply and noise may cause malfunctions or false alarms.

The descriptions in this section must be reflected on the designing of a system using the detector.

Using a stable power supply

The external output of the detector may be activated when the power is turned on, when momentary blackout occurs, or while the system is being stabilized. In such cases, use a UPS (uninterruptible power system), or take appropriate actions on the receiving side.

The detector must be provided with the following power supply.

Power supply voltage	24 VDC±10%: Terminal voltage of the detector				
Allowed time of momentary blackout	Up to 10 milliseconds (To recover from the momentary blackout for 10 milliseconds or more, restart the detector.)	Example of actions To ensure continuous operation and activation, install a UPS outside the detector.			
Others	Do not use it with a power supply of large power load or high-frequency noise.	Example of actions Use a line filter etc. to avoid the noise source if necessary.			

Introducing protective measures against lightning

If cables are installed outside the factory/plant, or if internal cables are installed in the same duct as the cables coming from outside the factory/plant, "lightning" will cause problems. Because lightning acts as a large emission source while cables act as a receiving antenna, devices connected to the cables may be damaged.

Lightning cannot be prevented. Cables installed in a metal conduit or under the ground cannot be completely protected from inductive lightning surge caused by lightning. Although complete elimination of disasters caused by lightning is impossible, the following protective measures can be taken.


Protection against lightning	 Take appropriate measures in accordance with the importance of the facilities and the environment. Provide protection by a lightning arrester (cable arrester). (Although inductive lightning surge can be transmitted through the cable, it is prevented by installing a lightning arrester before the field devices and central processing equipment. For information on how to use a lightning arrester, please contact the manufacturer.)
Grounding	In addition to lightning, there are more sources of surge noise. To protect units from these noise sources, the units must be grounded.

^{*} The lightning arrester has a circuit to remove a surge voltage which damages field devices, so that signals may be attenuated. Before installing a lightning arrester, verify that it works properly.

4 How to Use 4-4. How to install

4-4. How to install

<Installation Dimensions and Maintenance Space>

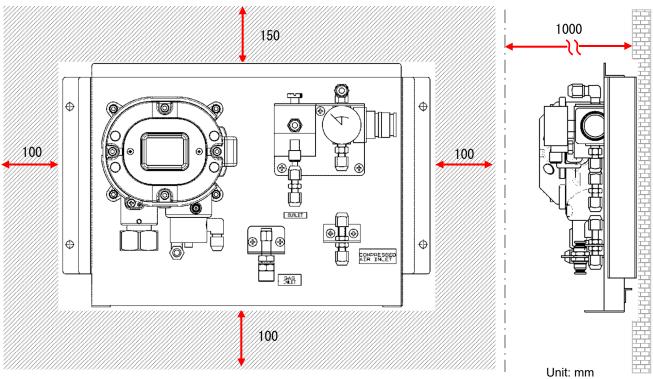

The following installation requirements must be met to install the detector.

- Attach the detector on the wall and others using four M5 screws.
- Tighten the hexagon socket head cap bolt fixing the lid and the main body with a tightening torque of 215.6 ±24.5N·cm.
- When closing the lid of the detector, make sure that there is no dust on screw, surfaces of the main body and lid. Then apply grease as specified by RIKEN KEIKI.



CAUTION

- <u>Do not install the detector in a place where maintenance of the detector cannot be performed or where handling the detector involves dangers.</u>
 - Regular maintenance of the detector must be performed.
 - Do not install the detector in a place where the machinery must be stopped when maintenance is performed in its inside, where parts of the machinery must be removed to perform maintenance, or where the detector cannot be removed because tubes or racks prevent access to it. Do not install the detector in a place where maintenance involves dangers, for example, near a high-voltage cable.
- If the detector is to be fixed on a wall or the like, install it properly where can hold its weight.

NOTE:


- Hexagon socket head cap bolt with strength class "A2-70" are used.
 - When you lost or replace it, we recommend that you ask our local sales office nearest you.
- Grease specified by RIKEN KEIKI: BARRIERTA JFE 552 (manufactured by NOK KLUBER) If you can not prepare the specified grease, use one that meets the following requirements.
 - 1. Material does not harden due to deterioration
 - 2. Volatile solvent-free
 - 3. Material does not cause corrosion at the surface
 - 4. Silicon-free
 - 5. Validation of suitability depends on the specifications of grease manufacturer

4-5. Installation procedure

<Attaching External Cable>

[ATEX/IECEx Specification]

The ATEX / IECEx specification comes with adapter A (NPT 1/2) as standard. Please prepare the Ex cable gland that is suitable for the adapter.

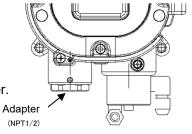


[TIIS Specification]

Cable gland, Rubber seal, Washer and Eccentric washer are mounted on SD-1D main body as shown below.

Attach the parts:

Pass a Cable (e.g. CVVS) through the Cable gland, Eccentric washer, Washer, and Rubber seal, and drawn into detector inside. (For wire methods, see "4-6 How to wire".) When installing the cable gland, wipe the cable gland mounting part, the hexagon socket set screw, the grounding screw, and the cable gland and wipe the specified grease.

Tightens Cable gland, and then tightens hexagon socket set screw (M4×6), and fix cable gland.

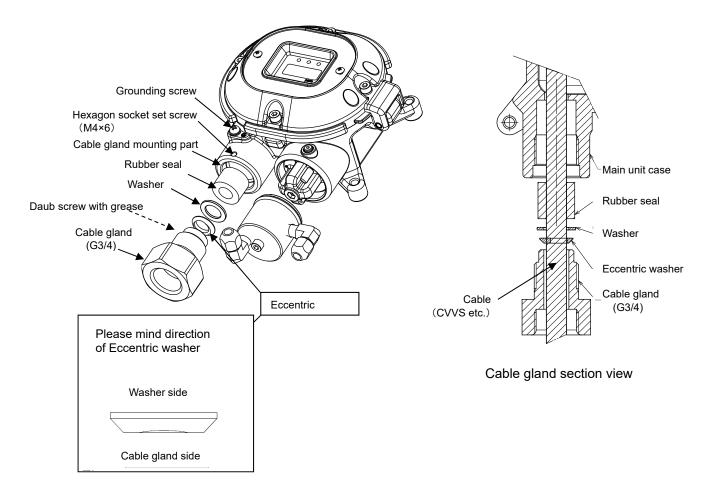



WARNING

 Do not replace parts at your sole discretion but contact RIKEN KEIKI if the transparent window has a crack or the explosion-proof joint surface is abnormal, or the clamping screw or bolt is changed, lost etc.



CAUTION

- Tighten 40 N·m or larger torque value to ensure the tightening cable gland and seal plug.
- Tighten the hexagon socket head cap screws fixing the cable gland with a tightening torque of 107.8±12.7N·m.

NOTE -

- Our company-specified grease : BARRIERTA JFE 552 (manufactured by NOK KLUBER) If you can not prepare the specified grease, use one that meets the following requirements.
 - 1. Material does not harden due to deterioration
 - 2. Volatile solvent-free
 - 3. Material does not cause corrosion at the surface
 - 4. Silicon-free
 - 5. Validation of suitability depends on the specifications of grease manufacturer

4-6. How to wire



CAUTION

 Be careful not to damage the internal electronic circuit when wiring. In addition, be careful not to apply stresses on the detector when (overweight) cables are installed.


- The power cables and signal cables must not be installed together with the motor power cables
 etc. When these cables must be installed together for unavoidable reasons, put the power
 cables and signal cables in a metal conduit. The conduit must be connected to a grounding
 circuit.
- When stranded wires are used, prevent wires from contacting each other.
- Use the dedicated handling lever to wire.
- Use appropriate cables to wire.

<Recommended Cable>

3-wire	CVVS 1.25mm ² or 2.0mm ² /3-core
4-wire	CVVS 1.25mm ² or 2.0mm ² /4-core

<Parts. length table of outside conductor lead-in>

Cable overall outer	Rubber seal inner	Washer inner	Clamp inner
diameter(mm)	diameter(mm)	diameter(mm)	diameter(mm)
From Φ9.6 to less than Φ10.5	Ф11	Ф12	Ф10.8
From Φ10.5 to less than Φ11.5	Ф12	Ф12	Ф11.8
From Φ11.5 to less than Φ12.5	Ф13	Ф14	Ф12.8
From Φ12.5 to less than Φ13.0	Ф13.5	Ф14	Ф13.8

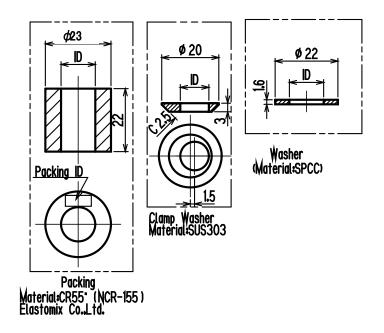

NOTE=


• The following table shows an example of overall outer diameters of cables. Use them for reference. The overall outer diameters must be checked because they somewhat vary between manufacturers.

Number of core	CVV 1.25mm ²	CVV 2mm ²	CVVS 1.25mm ²	CVVS 2mm ²
2	Ф9.5	Ф10.5	Ф10.0	Ф11.0
3	Ф10.0	Ф11.0	Ф10.5	Ф11.5
4	Ф10.5	Ф11.5	Ф11.0	Ф12.0
5	Ф11.5	Ф12.5	Ф12.0	Ф13.0
6	Ф12.5	Ф13.5	Ф13.0	Ф14.0


When the four hexagon socket head bolts of the gas detector head "SD-1D" are loosened and the lid is opened, the following terminal plate appears. Grounding terminals are provided: one inside and the other one outside.

<Figure of Terminal Plate>



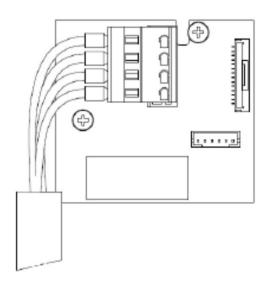

DC24V	DC+	1
DC24V	DC-	2
4-20mA	Sig+	3
+ HART	Sig-	4

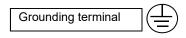

NOTE =

If HART functions are not used, 2p of terminal plate is being deemed to be power and the 4-20mA output common (-) terminal, and using as 3-wire is possible.

<Specifications of Terminal Plate>

Specifications of terminal plate

Rated voltage: 250 VAC

• Rated current: 12 A

However, it depends on cables to be used.

Connection conditions

• Cable: 0.25 - 2.5 mm²

• Bare wire length: 8 - 9 mm

Connecting tool: Dedicated handling lever (accessory) or driver (edge 3.5 x 0.5 mm)




CAUTION

The specified bare wire length must be observed when the wire insulation is peeled off. Improper clamping of the wire due to a shorter bare wire length may cause defective electric conduction or heating.

Catching the wire insulation due to a shorter bare wire length may cause defective electric conduction or heating.

Exposing the wire due to a longer bare wire length may cause defective insulation or a short circuit. Be careful not to break up the wire. If the wire is broken up when inserted to the terminal, this may cause defective insulation or heating.

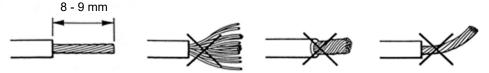

Compatible bar terminal

For a bar terminal, the following items are available.

- Bar terminal (ferrule): Model 216 Series (manufactured by WAGO)
- Crimping tool: Model VarioCrimp 4 (206-204) (manufactured by WAGO)



CAUTION

A bar terminal of the specified model must be used. Using other bar terminals invalidates the warranty of the performance.

<How to Connect to Terminal Plate>

When cables are connected to the connectors, use the dedicated lever or a flathead screwdriver to do it as shown below.



CAUTION

The right tools must be used.

In principle, one wire can be connected to one wiring hole.

When the wire is inserted into the driver slot by mistake, it does not contact the conductive part. This may cause defective electric conduction or heating.

When the wire is inserted under the spring by mistake, it does not contact the conductive part. This may cause defective electric conduction or heating.

NOTE -

<How to Use the Dedicated Handling Lever>



Push the lever with your finger to lower the spring in its inside.



While holding down the lever, insert the wire into the (round) wiring hole until it reaches the deepest point.

Once the lever is released, the wire is secured.

To check whether the wire is connected securely, pull the wire gently. (Do not pull the wire strongly.)

<Grounding>

Connect the detector to your grounding terminal with the external terminal







WARNING

- Before turning on the detector, never fail to connect it to the grounding terminal.
- For stable operation of the detector and safety, it must be connected to a grounding terminal. Do not connect the grounding wire to a gas pipe.
- The grounding must be made as D type grounding (below 100 Ω of grounding resistance).
- For the grounding wire, use cable lugs to safely connect it to a grounding terminal without looseness or twist.
- Use ring terminals to connect the grounding terminal with the ground and use the grounding wire with cross-sectional area of 4 mm² or more for the external grounding terminal.

<Wiring Example>

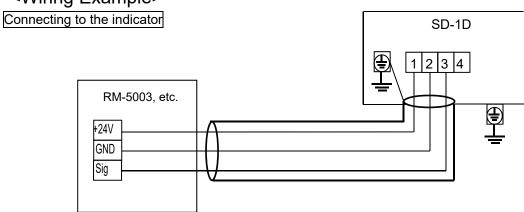

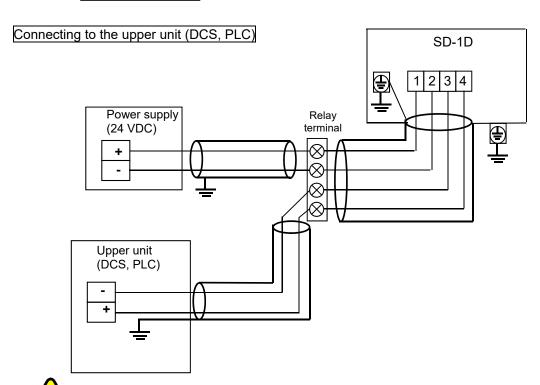



If HART communication is used, check so that wiring load resistance that constitute 4-20mA loops, amount to 250 Ω -300 Ω .

4 How to Use 4-7. How to Tube

4-7. How to Tube

As standard, either "Bs" or "SUS" union is attached to the sampling inlet/outlet (gas inlet, gas/air outlet, compressed air inlet) of the detector according to the specification.

The compatible tubes are tubes of ø6 (OD) - ø4 (ID) and ø8 (OD) - ø6 (ID). The tube must be installed with the inners and sleeves attached to prevent a leak. * See "3-3. Block diagram < Tubing Diagram>".

When the tube is cut, its cut point has a smaller inner diameter. Use a file etc. to expand the inner diameter of the cut point. To remove cut-dust remaining inside of the tube, blow compressed air into the tube before connecting it to the detector.

Some sample gases have highly adsorptive or corrosive property. Select the tube material taking into account of these precautions.

Be careful that the flow rate introduced to the detector is in the range of 0.8 - 2 L/min (the maximum pressure inside the flow path and sensor parts is 10.13 kPa <gauge pressure>).



WARNING

- The detector is designed to draw gases around it under the atmospheric pressure.
 Be sure that excessive pressure is not applied to the sampling inlet and outlet (gas inlet, gas/air outlet) of the detector.
- Detected gases must be exhausted from the gas/air outlet to which an exhaust tube is connected, to a point regarded as a safe place.



CAUTION

- The longer the tube of the gas inlet is, the longer it takes for a gas to reach the detector.
 Because some gases have a highly adsorptive property for the tube, resulting in a slow response and a lower reading than the actual value, the length of the gas inlet tube must be minimized.
- When the humidity in the sampling point is high, condensation may be formed inside of the
 tube. Make sure to avoid condensation when using a gas which is dissolved into water and
 corrodes contacted materials, such as a strong acid gas, because it may disable the detector
 for detecting gas and furthermore may corrode internal parts. Also avoid an excessive
 U-shaped or V-shaped tube piping.
- Determine the inlet for the sample gas, considering the airflow of the sample gas line and the gas generating process.
- To remove dust, never fail to attach a dust filter in the middle of the tube.
- It is needed to decide the length and material of the tube. Please contact RIKEN KEIKI for more information.

5

How to Operate


5-1. Preparation for start-up

Before connecting a power supply, read and understand the following precautions. Ignoring these precautions may cause an electric shock or damage the detector.

- Connect the detector to a grounding circuit.
- Check that the wiring is connected to external device properly.
- Check that the power supply voltage is compliant with the specifications.
- Check that there is no clogging or leak in the connected tube. (If the connected tube is clogged, pressure is applied to the sensor, causing errors and malfunctions.)
- Check that the filter is attached properly. (The filter is specified based on the gas to be detected.)

5-2. Basic operating procedures

Normally, the detection mode is used for normal operations. (The detection mode is activated after the power is turned on.)

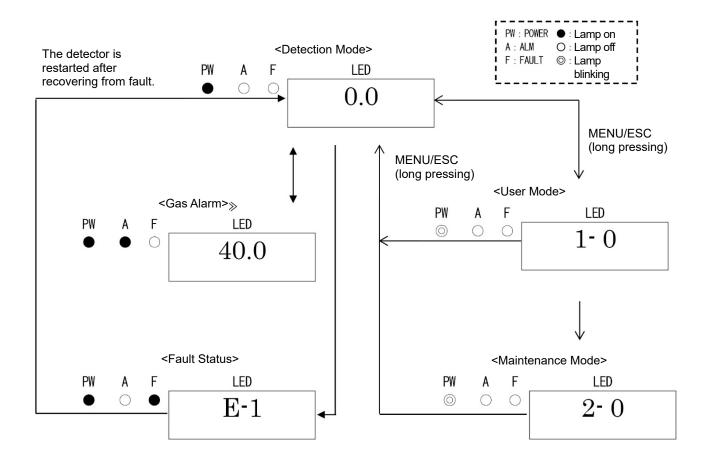



WARNING

When the detector enters other mode from the detection mode while an alarm is activated, the alarm is reset.

5-3. How to start the detector

- Before supplying power (24 VDC) to the detector, check that the detector is installed properly.
- Supply power (24 VDC) to the detector (turn on the detector).
- After the detector completes the start-up, it enters the detection mode swiftly.




CAUTION

- Do not turn off the detector during the initial clear. The detector is reading the internal memory during the initial clear.
- If the detector is installed newly or the new sensor is replaced, the sensor must be warmed up for a specified period which is determined depending on the type of the sensor after the detector is started.
- After the warm-up is completed, perform a calibration.

NOTE

<Start-up Operation Procedures> (approximately 25 seconds for system check of the detector and alarm deactivation)

Power on -> Initial clear (approximately 25 seconds) -> Detection mode

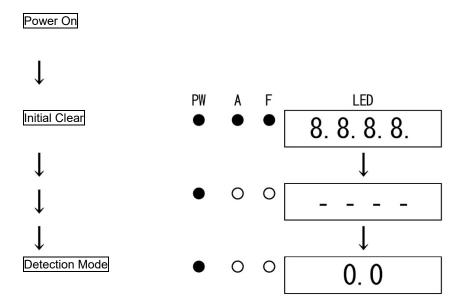

5 How to Operate 5-4. Modes

5-4. Modes

Details on each mode are provided as follows.



CAUTION

• Do not change the settings if not necessary. Changing the settings without understanding the specifications may cause malfunctions.

Mode	Item	LED display	Details
Detection Mode		Gas concentration	Normal state
Maintenance Mode (user)	ROM/SUM Display	1-0	Show the program version and others. This is not typically used by the user.
	Zero Adjustment	1-1	Perform the zero adjustment.
	Setting Display	1-2	Show various setting values.
	Switch to Maintenance Mode	1-3	Switch to the regular maintenance mode.
Maintenance Mode (regular maintenance)	Test Mode	2-0	Perform various tests. 2-0.0 Gas Test 2-0.1 Alarm Test 2-0.2 Fault Test 2-0.3 LED Test 2-0.4 Memory Test
	Zero Adjustment	2-1	Perform the zero adjustment.
	Span Adjustment	2-2	Perform the span adjustment.
	Zero/Span Initialization	2-3	Initialize zero/span values.
	Environmental Setting	2-4	Used for various environmental settings. 2-4.0 Sensor Power Supply ON/OFF 2-4.1 INHIBIT Setting 2-4.2 Alarm Setpoint Setting 2-4.3 Alarm Delay Time Setting 2-4.4 Alarm Pattern Setting 2-4.5 Zero Suppression Pattern Setting 2-4.6 Zero Suppression Value Setting 2-4.7 Not used. 2-4.8 Not used. 2-4.9 Zero Follower Selection 2-4.A Maintenance Mode External Output Setting 2-4.B External Output Setting 2-4.C Alarm Test External Output Setting 2-4.D Sensor Operation Start Setting 2-4.F Sensor Fault Alarm Pattern Setting
	Display	2-5	Display various electrical settings. This is not typically used by the user.
	Switch to Factory Mode	2-6	Not used.
	Switch to User Mode	2-7	Returns to the user mode.


5-5. Maintenance mode (User)



WARNING


After the adjustment is completed, never fail to press MENU/ESC key to return to the detection mode.

(If the detector remains in the user mode, it automatically returns to the detection mode in ten hours.)

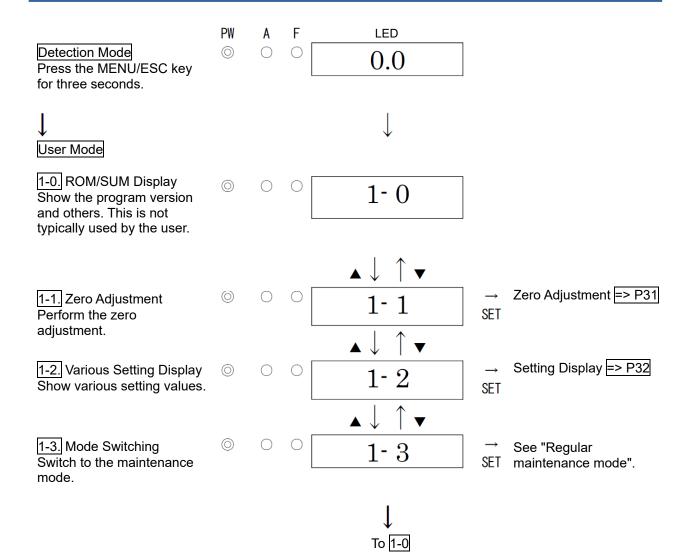

<Zero Adjustment "1-1">

This is used to perform the zero adjustment.

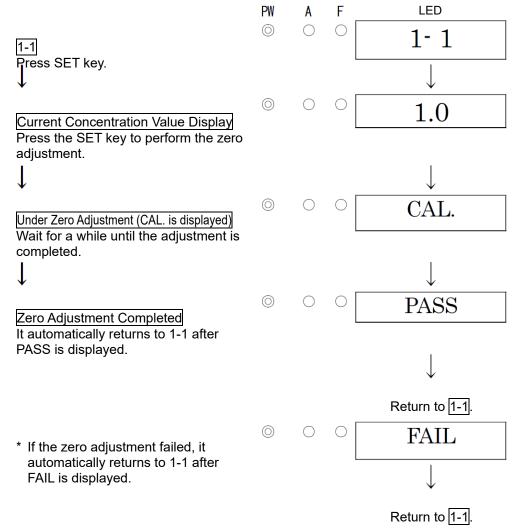


NOTE:

• If the zero calibration failed since the zero point was significantly fluctuated from around zero, it returns to 1-1 after FAIL rather than PASS is displayed. In this case, the zero adjustment has not been completed.

<Setting Display "1-2">

Show various setting values.

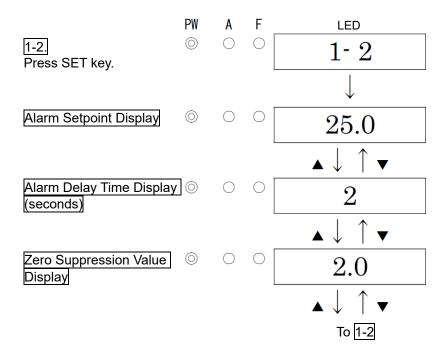


5-6. Flow Rate Adjustment

Set the flow rate according to the following steps.

- (1) Check that the supply side of compressed air is closed.
- (2) After making sure that the lock ring of the compact regulator adjusting knob is located at the front side (if it is at the far side, the knob will not turn), turn the adjusting knob to the LOW side (counterclockwise) until it stops. (Figure 1)
- (3) Turn the needle valve clockwise until it stops, and then turn it counterclockwise by two turns. (Figure 2)
- (4) Open the supply side of compressed air.
- (5) Turn the compact regulator adjusting knob slowly to the HIGH side (clockwise) until the float of the MC filter with flow monitor makes contact with the upper stopper and stops, and then move the lock ring to the far side to lock the adjusting knob.
- (6) Slowly turn the needle valve clockwise until the float of the MC filter with flow monitor makes contact with the upper stopper and moves up and down by one to two millimeters. (Figure 3)

The flow rate setting is now completed.

* If the float of the MC filter with flow monitor comes in and out of sight during operation, turn the needle counterclockwise until the float makes contact with the upper stopper and moves up and down by one to two millimeters and adjust the flow rate. If the above does not help the float to behave normally, it may indicate clogging in the gas inlet or MC filter, or other problems. In this case, perform maintenance.

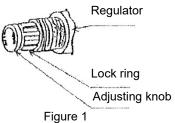



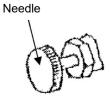


Figure 2

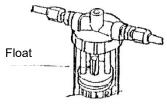


Figure 3

5-7. How to exit

Turn off the detector according to the followings.

- Stop supplying compressed air to the detector.
- Turn the needle valve clockwise until it stops.
- Move the adjusting knob lock ring to the front side and turn the knob to the LOW side (counterclockwise) until it stops.
- Turn off the power supply (24 VDC) to the detector.



WARNING

- When the detector is turned off, an alarm may be triggered on the upper (central) system.
- Before turning off the detector, INHIBIT (point skip) on the upper (central) system must be
 activated. Decide whether the power can be turned off by checking the operation of the devices
 connected to the external output or external contact output terminal of the detector.

6

Operations and Functions

6-1. Gas alarm activation

Gas alarm: Triggered when the concentration of detected gas reaches or exceeds the alarm setpoint value. <<Auto-Reset>>

NOTE:

The alarm setpoint is factory-set. Although the alarm delay time (standard: 2 seconds) works in the detector to prevent a false activation, it can be cancelled if not needed.

<Display Operation>

Gas Concentration Display

Power Indicator Lamp (POWER: Green)

During operation, this lights up continuously.


Alarm Indicator Lamp (ALM: Red)

It lights up when the alarm setpoint value is reached to or exceeded.

<Alarm Activation>

It lights up when the gas concentration reaches or exceeds the alarm setpoint value. (only when the alarm is used)

The alarm activation is reset automatically when the gas concentration drops below the alarm setpoint value.

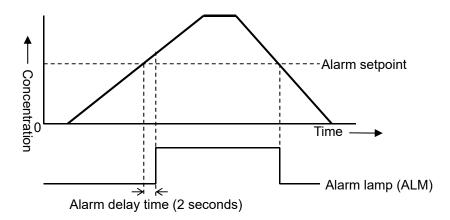

<Response to Gas Alarm>

A gas concentration value exceeds the alarm setpoint

When a gas alarm is triggered, take actions in accordance with your management rules of gas alarm. Normally, take the following actions.

• Check the reading of the detector.

NOTE:

If a gas leak is momentary, the reading may already have dropped when checking it. In addition, when the alarm is triggered by noise or other incidental conditions other than a gas, the reading may have already dropped.

- Based on your management rules of gas alarm, no one can be allowed to access the monitored zone to ensure safety.
- If the gas concentration display continues to be displayed, close the main valve of the gas, and then check that the gas concentration reading dropped.
- Access the gas leak point, equipped with a protective gear to avoid dangers caused by possibly remaining gases, and check whether gases remain or not by using a portable gas detector.
- Check that the point is free from dangers, and take actions to fix the gas leak.

6-2. Fault alarm activation

A fault alarm is triggered when the detector detects abnormalities. After a fault alarm is triggered, the fault lamp (yellow) lights up and an error message is displayed on the LED. Determine the causes and take appropriate actions.

After the detector is successfully returned from the fault, it restarts with the process normally performed right after it is turned on (initial clear).

If the detector has problems and is repeatedly malfunctioning, contact RIKEN KEIKI immediately.

<Display Operation>

Fault Detail Display

Display a message indicating the fault detail.

Fault Lamp (FAULT: Yellow)

This lights up when a failure occurs.

NOTE

For information on malfunctions (error messages), see "9. Troubleshooting".


6-3. External output operation

Signa	al Transmission System	Electric current transmission (non-isolated) 4 – 20 mA
Transmission Path		CVVS
Transmission Distance		CVVS 1.25 mm ² : Maximum 1.25 km
		CVVS 2.0 mm ² : Maximum 2.0 km
Conn	nection Load Resistance	Below 300 Ω
	Mode	4 - 20 mA(output value)
1	Power Off	0 mA
2	Initial Clear	Depending on the setting of the section 9
		2.5 mA setting: 2.5 mA
		4 mA, HOLD, 4 - 20 mA setting: 4 mA
3	Detection Mode(No alarm)	4 - 20 mA (concentration output)
4	Detection Mode(Gas alarm)	4 - 20 mA (concentration output)
5	Detection Mode	Less than 22mA:lenear output (concentration output)
	(Full scale over)	Exceed 22mA:22mA(Fixed)
6	Fault Alarm	0.5 mA (Fixed)
7	INHIBIT	Depending on the setting of the section 9
		2.5 mA setting: 2.5 mA
		4 mA, HOLD, 4 - 20 mA setting: 4 mA
8	Alarm Test	Output ON setting: 4 - 20 mA (concentration output)
		Output OFF setting: 4 mA
9	Maintenance Mode(User)	2.5 mA setting: 2.5 mA
	Maintenance Mode(Regular	4 mA setting: 4 mA
	Maintenance)	HOLD setting: The previous value retained
		4-20 mA setting: 4 - 20 mA (concentration output)

Example of Gas Concentration and External Output

4 - 20 mA specification

(Maintenance output: 2.5 mA setting)

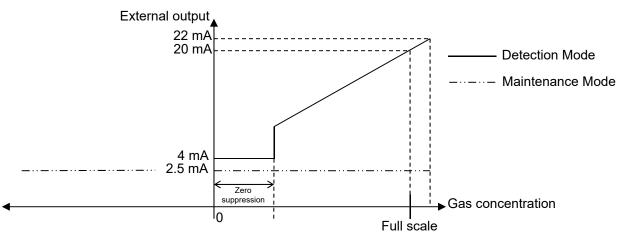



CALITION


- The 4 20 mA output is already adjusted. In case of over scale, an output will not exceed 22 mA.
- Output during INHIBIT or initial clear is based on 4 20 mA output setting in the maintenance mode.

In particular, when the detector is started or the specification is changed, be careful about 4-20 mA output setting. Understand how the detector functions, and take actions, if necessary, so that the signal receiver side can prepare to avoid false alarms.

6-4. Other functions

<Suppression Function>

The sensors used with the detector are influenced by environmental changes (temperature, humidity, and other characteristics) or interference gases (interference characteristics) in no small measure, which affects the reading. Therefore, the reading might be fluctuated around zero even in a normal environment. This function obscures influences by environmental changes and interference gases around zero that have no meaning for your management rules of gas alarm. This function is used to hide (suppress) the fluctuation of the reading under the setting value, indicating zero.

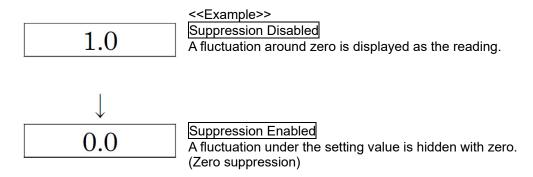

NOTE -

- The suppression function is factory-set. The standard setting value is TYPE GP H: 2% FS and TYPE NC H: 10% FS.
- In the maintenance mode, this function is disabled and the fluctuation of the reading under the setting value is displayed.



CAUTION

A reading under zero is suppressed with the 10% FS suppression.

A reading that is 10% FS or more under zero is displayed as "-0.0", which prevents an accurate gas detection and needs the zero adjustment.

7

Maintenance

The detector is an important instrument for the purpose of safety.

To maintain the performance of the detector and improve the reliability of safety, perform a regular maintenance.

7-1. Maintenance intervals and items

• Daily maintenance: Perform maintenance before beginning to work.

• Monthly maintenance: Perform maintenance on the alarm circuit (alarm test) once a month.

• Regular maintenance: Perform maintenance once or more for every six months to maintain the

performance as a safety unit.

Maintenance item	Maintenance content	Daily mainte- nance	Monthly mainte- nance	Regular mainte- nance
Power supply check	Check that the power lamp lights up.	0	0	0
Concentration display check	Check that the concentration display value is zero. When the reading is incorrect, perform the zero adjustment after ensuring that no interference gases exist around it.	0	0	0
Flow rate check	Check the flow rate to find abnormalities.	0	0	0
Filter check	Check the dust filter for dust or clogging.	0	0	0
Alarm test	Inspect the alarm circuit by using the alarm test function.	_	0	0
Span adjustment	Perform the span adjustment by using the calibration gas.	_	_	0
Gas alarm check	Check the gas alarm by using the calibration gas.	_	_	0

<About Maintenance Services>

We provide services on regular maintenance including span adjustment, other adjustments and maintenance.

To make the calibration gas, dedicated tools, such as a gas cylinder of the specified concentration and gas sampling bag must be used.

Our qualified service engineers have expertise and knowledge on the dedicated tools used for services. along with other products. To maintain the safety operation of the detector, please use our maintenance service.

The following are typical maintenance services. For more information, please contact RIKEN KEIKI.

Main Services

Checks the power supply voltage. Power supply check

Verifies that the power lamp lights up.

(Verifies that relevant points can be identified on the system.) (When a UPS (uninterruptible power system) is used, checks the

operation with the UPS.)

Concentration display check Verifies that the concentration display value is zero by using the zero

Performs the zero adjustment (fresh air adjustment) if the reading is

incorrect.

Flow rate check Checks the flow rate indicator to find abnormalities.

> Checks the flow rate by using an external flow meter to verify the correctness of the flow rate indicator on the detector. If the flow rate is

incorrect, performs the flow rate adjustment.

Filter check Checks the dust filter for dust or clogging.

Replaces a dirty or clogged dust filter.

Alarm test Inspects the alarm circuit by using the alarm test function.

Checks the alarm lamps. (Checks each activation of ALM1 and

Checks the external alarm. (Checks the activation of the external

alarm, such as a buzzer.)

Span adjustment Performs the span adjustment by using the calibration gas.

Checks the gas alarm by using the calibration gas.

Checks the alarm. (Checks triggering of alarm when the alarm

setpoint is reached.)

Checks the delay time. (Checks time to delay until the alarm is

triagered.)

• Checks the alarm lamps. (Checks each activation of ALM1 and

ALM2.)

Checks the external alarm. (Checks the activation of external alarms,

such as a buzzer and reset signal.)

Cleaning and repair of

device

Checks dust or damage on surface, cover or internal parts of the

detector, cleans and repairs such parts of the detector.

Replaces parts which are cracked or damaged.

(Visual diagnosis) Device operation check

Gas alarm check

Uses the keys to check the operation of functions and parameters.

Replacement of consumable

Replaces consumable parts, such as a sensor, filter and pump.

parts

7-2. Maintenance mode (Regular maintenance)





WARNING

After the adjustment is completed, never fail to press MENU/ESC key to return to the detection mode.


(If the detector remains in the regular maintenance mode, it automatically returns to the detection mode in ten hours.)

Mode	Item	LED display	Details
	Test Mode	2-0	Perform various tests. 2-0.0 Gas Test 2-0.1 Alarm Test 2-0.2 Fault Test 2-0.3 LED Test 2-0.4 Memory Test
	Zero Adjustment	2-1	Perform the zero adjustment.
	Span Adjustment	2-2	Perform the span adjustment.
	Zero/Span Initialization	2-3	Initialize zero/span values.
Maintenance Mode (regular maintenance)	Environmental Setting	2-4	Used for various environmental settings. 2-4.0 Sensor Power Supply ON/OFF 2-4.1 INHIBIT Setting 2-4.2 Alarm Setpoint Setting 2-4.3 Alarm Delay Time Setting 2-4.4 Alarm Pattern Setting 2-4.5 Zero Suppression Pattern Setting 2-4.6 Zero Suppression Value Setting 2-4.7 Not used. 2-4.8 Not used. 2-4.9 Zero Follower Selection 2-4.A Maintenance Mode External Output Setting 2-4.B External Output Setting 2-4.C Alarm Test External Output Setting 2-4.D Sensor Operation Start Setting 2-4.E Password Setting 2-4.F Sensor Fault Alarm Pattern Setting
	Display	2-5	Display various electrical settings. This is not typically used by the user.
	Switch to Factory Mode	2-6	Not used.
	Switch to User Mode	2-7	Returns to the user mode.

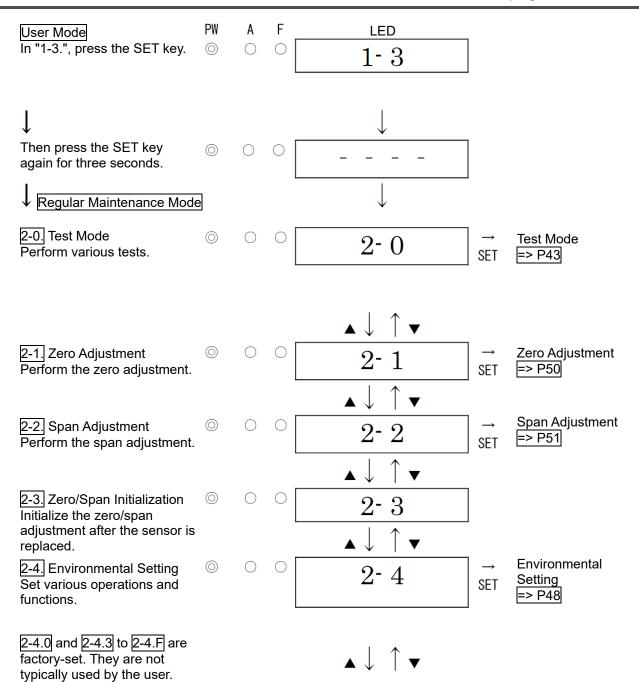

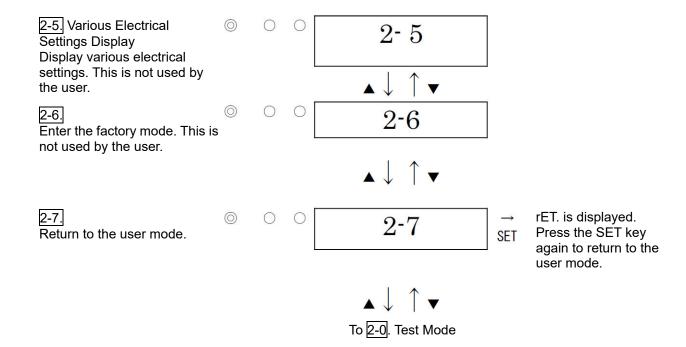

<Test Mode "2-0">

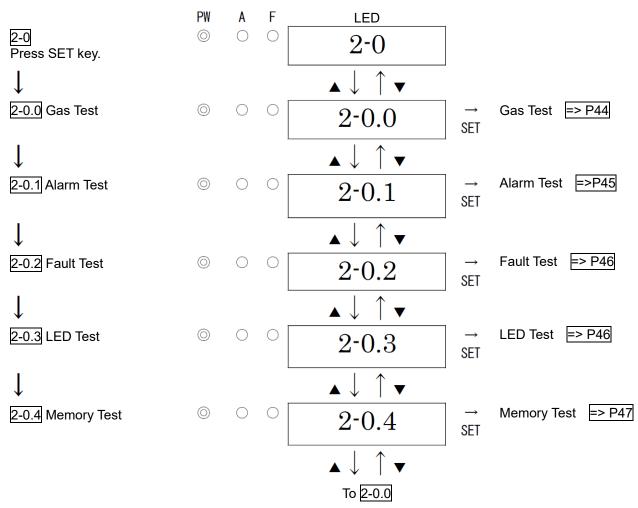




WARNING

- Before starting the alarm test (transmission test), provide a notification to the related sections so
 that they can prepare for false abnormalities (external output signals). After the test is completed,
 never fail to press MENU/ESC key to return to the detection mode. (If the detector remains in the
 alarm test mode, it automatically returns to the detection mode in ten hours.)
- In the alarm test mode, the gas concentration equal to the reading is output even in the maintenance mode depending on the setting. Take actions, if necessary, so that the signal receiver side can prepare to avoid false alarms.

<Gas Test "2-0.0">

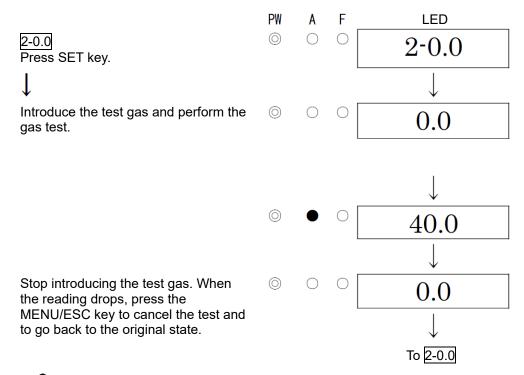




WARNING


Because the contact and gas concentration output can be activated by a gas test even in the maintenance mode depending on setting, be careful to perform the test.

<Alarm Test "2-0.1">

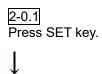

Perform the gas alarm test by increasing or decreasing the reading with the ▲ or ▼ key.

Press the MENU/ESC key to cancel the test and to go back to the original state.

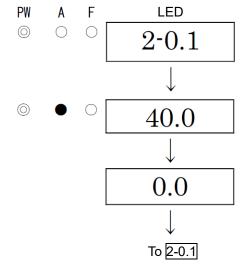




WARNING

Because the contact and gas concentration output can be activated by an alarm test even in the maintenance mode depending on setting, be careful to perform the test.

<Fault Test "2-0.2">

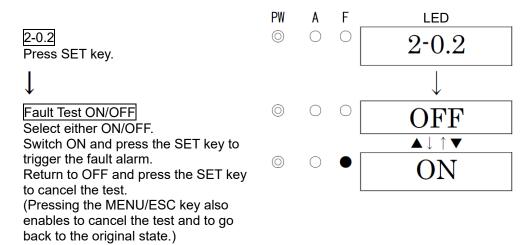





WARNING

Because the contact and gas concentration output can be activated by a fault test even in the maintenance mode depending on setting, be careful to perform the test.

<LED Test "2-0.3">

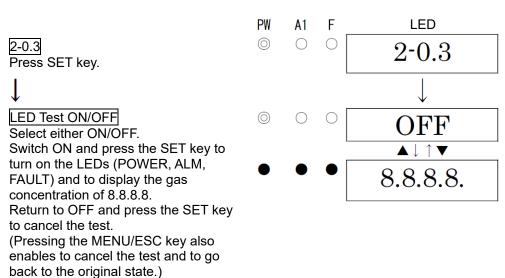

<Memory Test "2-0.4">

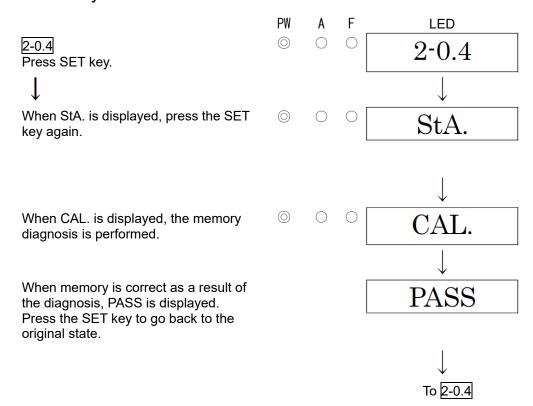


NOTE =


When abnormalities are found in memory as a result of the diagnosis, PASS is not displayed. F-RA is displayed for the RAM fault, and F-RO is displayed for the ROM fault. For both the RAM fault and ROM fault, F-RA and F-RO are displayed alternately.

<Environmental Setting "2-4">

Set various operations and functions in the environmental setting.

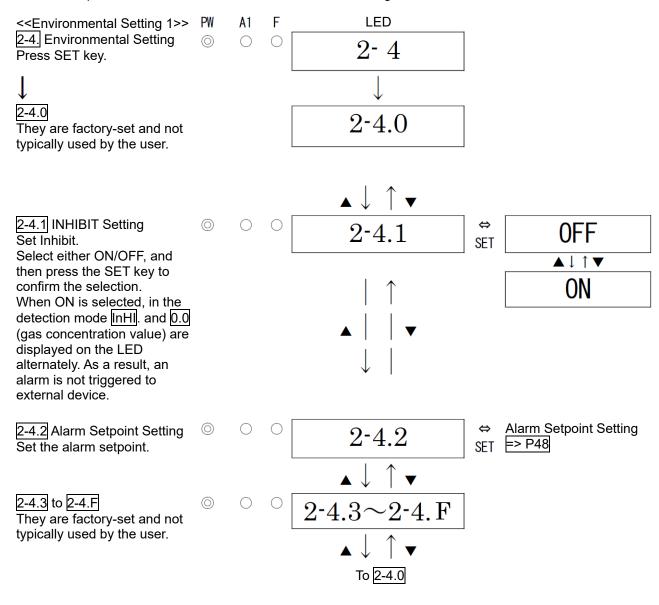

<Alarm Setpoint Setting "2-4.2">

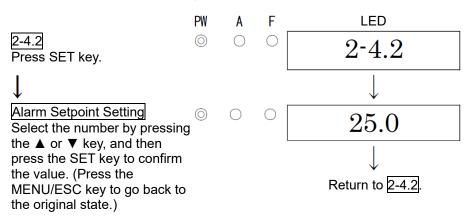

NOTE =

The value more than 60% of detection range cannot set it.


7 Maintenance 7-3. Calibration method

7-3. Calibration method

Perform a calibration in each mode (zero adjustment mode and span adjustment mode) using the calibration gas.

- Zero adjustment gas
- Calibration gas (collected in a gas sampling bag)
- · Gas sampling bag for exhaust gas

<Device Connection Example>

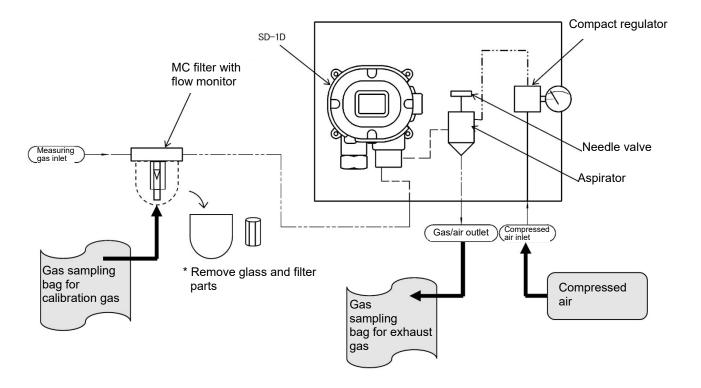

7 Maintenance 7-3. Calibration method

<Zero Adjustment "2-1">

This is used to perform the zero adjustment.




WARNING

When the zero adjustment is performed in the atmosphere, check the atmosphere for freshness before beginning the adjustment. If other gases exist, the adjustment cannot be performed properly, thus leading to dangers when the gas leaks.

NOTE:

 Before starting the zero adjustment, provide the detector with the zero adjustment gas and wait until the indicator is stabilized.

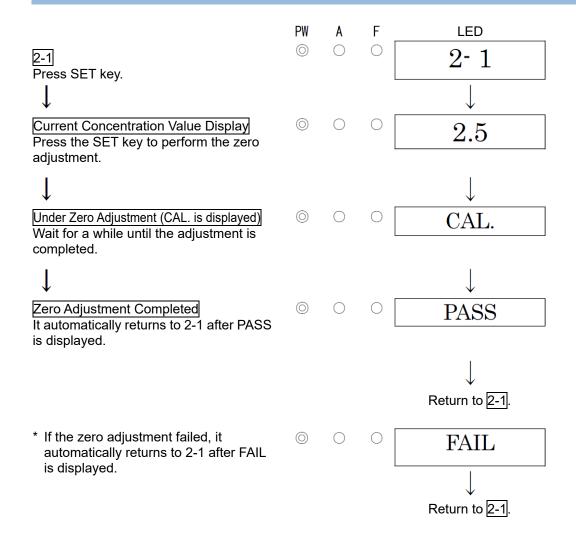

NOTE


 If the zero calibration failed since the zero point was significantly fluctuated from around zero, it returns to 2-1 after FAIL rather than PASS is displayed. In this case, the zero adjustment has not been completed. 7 Maintenance 7-3. Calibration method

This is used to perform the span adjustment.



CAUTION

 Before starting the span adjustment, provide the detector with the span adjustment gas and wait until the indicator is stabilized.

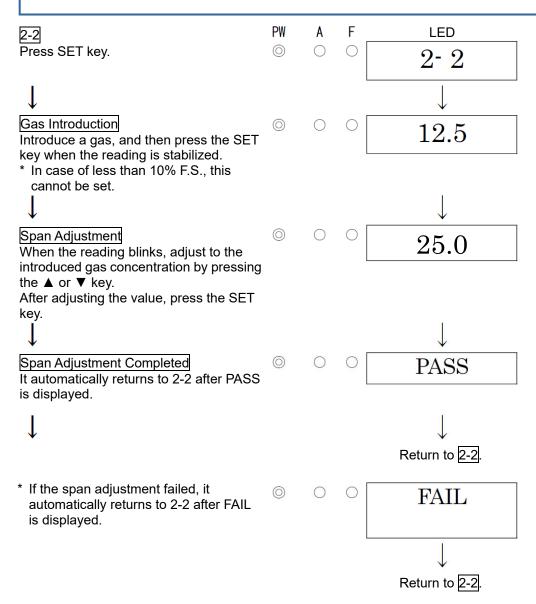

NOTE:

• If the span adjustment failed since the reading was significantly fluctuated from the introduced gas concentration, it returns to 2-2 after FAIL rather than PASS is displayed. In this case, the span adjustment has not been completed.


Check if the correct concentration span adjustment gas has been provided and check the gas adjustment tool for a gas leak. If there are mistakes, perform the span adjustment again. If the span adjustment cannot be performed even when there is no mistake or after recalibration, the gas sensor life might have expired. After turning off the power supply, please contact RIKEN KEIKI.

7-4. Replacement parts

<Sensor Replacement>

Gas sensor replacement is according to the following procedures.

- (1) Turn off the power supply (24VDC) to the detector.
- (2) After loosened set screw by hex wrench (nominal size 2),remove sensor guard by hex wrench (nominal size 6).
- (3) Remove the sensor. Pinch top of sensor (sintered metal portion) by using finger, and pull out it.
- (4) Mount a new sensor. There are five pins for sensor, but a pin is longer than the others to show the reference, and equip detection unit with sensor .When put on the sensor, do NOT scratch mating portion of side of the sensor and adapter inside.
- (5) After replacing a sensor, put on a sensor guard and set screw firmly. When installing the sensor guard, make sure that the guard mounting part, set screw, and sensor guard are free of dust, and apply grease specified by RIKEN KEIKI.
- (6) After sensor replacement, turn on the power and warm up, then do the zero point adjustment and span adjustment by [7-3. Gas calibration method].

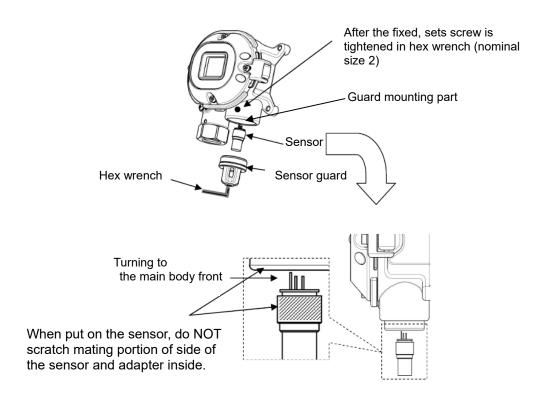

NOTE =

- Tighten the set screw of the sensor guard at 107.8±12.7N·cm.
- The gas calibration using the standard gas is required after the sensor is replaced. Please request it to our overseas sales department or local representatives.
- Grease specified by RIKEN KEIKI : BARRIERTA JFE 552 (manufactured by NOK KLUBER)

If you can not prepare the specified grease, use one that meets the following requirements.

- 1. Material does not harden due to deterioration
- 2. Volatile solvent-free
- 3. Material does not cause corrosion at the surface
- 4. Silicon-free
- 5. Validation of suitability depends on the specifications of grease manufacturer

NOTE -

The gas calibration using the standard gas is required after the sensor is replaced. Please request it to our overseas sales department or local representatives.



WARNING

- Do NOT exchange any parts while turn on electricity. It may happen fire.
- Turn off the power supply, and then replace parts.

<Replacement of Regular Replacement Parts>

List of recommended regular replacement parts

No.	Name	Maintenance intervals	Replacement intervals	Quantity (pieces per unit)
1	Guard assembly	6 months	3 - 8 years	1
2	Aspirator cap	6 months	3 - 8 years	1

^{*} The operation must be checked after replacement by a qualified service engineer. For the stable operation of the detector and safety, ask a qualified service engineer to take care of replacement of the parts. Request RIKEN KEIKI for operation check.

NOTE =

The above replacement intervals are recommendation only. The intervals may change depending on the operating conditions. These intervals do not mean the warranty periods either. The result of the daily or regular maintenance may determine when to replace the parts.

8

Storage, Relocation and Disposal

8-1. Procedures to store the detector or leave it for a long time

The detector must be stored under the following environmental conditions.

- In a dark place under the normal temperature and humidity away from direct sunlight
- In a place where gases, solvents or vapors are not present

8-2. Procedures to relocate the detector or use it again

When the detector is relocated, select a new place in accordance with "4-2. Precautions for installation sites" and "4-4. How to install".

For information on wiring, see "4-6. How to wire". The unpowered time must be minimized when the detector is relocated.



CAUTION

 When using a relocated or stopped/stored detector again, never fail to perform a gas calibration. For information on readjustment including a calibration, please contact RIKEN KEIKI.

8-3. Disposal of products

When the detector is disposed of, it must be treated properly as an industrial waste in accordance with the local regulations.

9

Troubleshooting

The Troubleshooting does not explain the causes of all the malfunctions which occur on the detector. This simply helps to find the causes of malfunctions which frequently occur. If the detector shows a symptom which is not explained in this manual, or still has malfunctions even though remedial actions are taken, please contact RIKEN KEIKI.

<Abnormalities on Unit>

Symptom/Display	FAULT	Causes	Actions
		The wiring is not correct.	Connect the wiring properly.
		The terminal plate is removed.	Connect the terminal plate properly.
The power cannot be turned on.	_	Abnormalities/mome ntary blackout of power supply system	Provide the rated voltage. Take measures such as checking or adding the UPS, power supply line filter and insulation transformer.
		Cable abnormalities (open circuit/not connected/short circuit)	Check the wiring of detector and related devices around it.
Abnormal operations		Disturbances by sudden surge noise, etc.	Turn off and restart the detector. If such a symptom is observed frequently, take appropriate measures to eliminate the noise.
		The sensor is not connected or improperly connected.	Check if the sensor cable is securely fastened to the terminal plate.
Sensor abnormalities E-1	•	Zero drift caused by environmental changes or aging deterioration is out of the range of zero follower.	Perform zero adjustment. If the symptom persists after the zero adjustment, replace the sensor with a new one.
		Faults of the sensor	Replace the sensor with a new one.
System		The rated voltage is not supplied to the detector.	Check the power supply, and supply the rated voltage.
abnormalities E-9	•	Abnormalities of ROM, RAM or EEPROM inside of the detector	Please contact RIKEN KEIKI.

<Abnormalities of Readings>

Abnormalities of Readings Symptoms	Causes	Actions
	Drifting of sensor output	Perform zero adjustment.
The reading rises (drops) and it remains	Presence of interference gas	Disturbances by interference gases, such as solvents, cannot be eliminated completely. For information on actions, such as removal filter, please contact RIKEN KEIKI.
SO.	Slow leak	A very small amount of the gas to be detected may be leaking (slow leak). Because ignoring it may cause dangers, take a remedial measure, i.e., taking actions the same as those for the gas alarm.
	Environmental changes	Perform the zero adjustment (AIR adjustment).
	Presence of interference gas	Disturbances by interference gases, such as solvents, cannot be eliminated completely. For information on actions, such as removal filter, please contact RIKEN KEIKI.
A gas alarm is triggered despite of no gas leak and no other	Disturbance by noise	Turn off and restart the detector. If such a symptom is observed frequently, take appropriate measures to eliminate the noise.
abnormalities at the detection point.	Sudden change in the environment	When the environment (temperature etc.) changes suddenly, the detector cannot adjust to it and is affected by it. In some cases, the detector triggers an indication alarm. Because the detector cannot be used under sudden and frequent environmental changes, any preventive actions to eliminate them should be taken by the user.
	Clogged dust filter	Replace the dust filter.
	Bended, clogged, or leaked suction tube or exhaust tube	Fix the defective parts.
Slow response	Condensation is formed inside the suction tube.	Fix the defective parts.
	Deteriorated sensor sensitivity	Replace the sensor with a new one.
Span adjustment	Improper calibration gas concentration	Use the proper calibration gas.
impossible	Deteriorated sensor sensitivity	Replace the sensor with a new one.

10

Product Specifications

10-1. List of specifications

[SD-1D-AS (TYPE GP F	H)] <atex iecex="" specifications=""></atex>
Model	SD-1D-AS
Туре	TYPE GP H
Detection principle	Catalytic combustion method
Gas to be detected	Combustible gas
Applicable gas detector head	SD-1D (TYPE GP H)
Concentration display	LED(4digits • 7segments)
Detection range	0 - 100%LEL
Resolution	0.5%LEL
Detection method	Aspirator suction method
Sampling condition	Atmosphere equivalent (Compressed air: 0.1 - 0.7MPa • Consumption Max. 3L/min <atmospheric conversion="">)</atmospheric>
Flow rate	0.8 ±0.1L/min
Alarm setpoint	25% LEL [standard]
Power display	POWER lamp lighting(green)
Alarm accuracy (under the same conditions)	Within ±25% to the alarm setpoint value
Alarm delay time (under	Within 30sec(when introducing 1.6 times thicker gas than alarm setpoint
the same conditions)	value)(without piping delay time)
Gas alarm type	Single alarm(H)
Gas alarm display	ALM lamp lighting(red)
Gas alarm pattern	Auto-recover
Fault alarm/self	System failure/Sensor failure
diagnosis	
Fault alarm display	FAULT lamp lighting(yellow)/content display
Fault alarm pattern	Auto-recover
Transmission system	Two-wire analog transmission + digital transmission(HART communication) or Three-wire analog transmission(in common with power supply <power supply,signal,common="">)</power>
Transmission specifications	4 - 20 mA DC (linear/load resistance under 300 Ω)
Transmission cable	CVVS 1.25 mm ² - 4-core or 3-core CVVS 2.0mm ² - 4-core or 3-core
Transmission distance	1.25km or less in case of CVVS 1.25mm ² 2.0km or less in case of CVVS 2.0mm ²
Power supply	24 VDC±10%
Power consumption	MAX.3W
	Adapter A <npt1 2=""> or adapter B<npt3 4=""> or</npt3></npt1>
Cabling port	Pressure proof packing gland <g3 4=""> (Compatible cables ϕ9.6 - 13.0mm in outer diameter)</g3>
Piping port	Gas inlet: Rc1/4(with BS half union <for cu="" pipe=""> or SUS half union<for pipe="" sus=""> for O.D \phi6-1t)</for></for>

	Gas outlet: BS union(for Cu pipe) or SUS union(for SUS pipe) for O.D ϕ 8-1t Compressed air inlet: BS union(for Cu pipe) for O.D ϕ 8-1t
Initial clear	Approx. 25 seconds
Operating temperatures	-20 - +60°C (non-rapidly-vary)
Operating humidities	Below 95% RH (non-condensing)
Structure	Wall mounting sampling unit(Cu Specification or SUS Specification)
Explosion protected construction	Flame proof structure
Explosion-proof grade	II 2G Ex db II C T5 Gb(ATEX) / Ex db II C T5 Gb(IECEx)
Dimensions	Approx. 400 (W) x 265 (H) x 102 (D) mm
Weight	Approx. 5.6kg
Color	Munsell 7.5BG5/2


^{*} When a half-union for gas IN side is changed, check also the external filter (IN/OUT diameter) carefully.


[SD-1D-AS (TYPE NC H)] <ATEX/IECEx Specifications>

	H)] <atex iecex="" specifications=""></atex>
Model	SD-1D-AS
Type	TYPE NC H
Detection principle	New ceramic catalytic method
Gas to be detected	Combustible gas
Applicable gas	
detector head	SD-1D (TYPE NC H)
Concentration display	LED(Adigita - Zacamento)
	LED(4digits • 7segments)
Detection range	Depend on detection gas
Resolution	Depend on detection gas
Detection method	Aspirator suction method
Compling condition	Atmosphere equivalent (Compressed air: 0.1~0.7MPa ⋅ Consumption Max.
Sampling condition	3L/min <atmospheric conversion="">)</atmospheric>
Flow rate	0.8 ±0.1 L/min
Alarm setpoint	Depend on detection gas
Power display	POWER lamp lighting(green)
Alarm accuracy (under the same conditions)	Within ±25% to the alarm setpoint value
Alarm delay time (under	Within 30sec(when introducing 1.6 times thicker gas than alarm setpoint
the same conditions)	value)(without piping delay time)
Gas alarm type	Single alarm(H)
Gas alarm display	ALM lamp lighting(red)
Gas alarm pattern	Auto-recover
Fault alarm/self	System failure/Sensor failure
diagnosis	
Fault alarm display	FAULT lamp lighting(yellow)/content display
Fault alarm pattern	Auto-recover
r dant diam. pattern	Two-wire analog transmission + digital transmission(HART communication) or
Transmission system	Three-wire analog transmission(in common with power supply <power< td=""></power<>
	supply,signal,common>)
Transmission	
	$ $ 4 - 20 mA DC (linear/load resistance under 300 Ω)
specifications	
specifications	·
specifications Transmission cable	CVVS 1.25 mm ² - 4-core or 3-core
Transmission cable	CVVS 1.25 mm ² - 4-core or 3-core CVVS 2.0mm ² - 4-core or 3-core
•	CVVS 1.25 mm ² - 4-core or 3-core CVVS 2.0mm ² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm ²
Transmission cable Transmission distance	CVVS 1.25 mm ² - 4-core or 3-core CVVS 2.0mm ² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm ² 2.0km or less in case of CVVS 2.0mm ²
Transmission cable Transmission distance Power supply	CVVS 1.25 mm ² - 4-core or 3-core CVVS 2.0mm ² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm ² 2.0km or less in case of CVVS 2.0mm ² 24 VDC±10%
Transmission cable Transmission distance	CVVS 1.25 mm² - 4-core or 3-core CVVS 2.0mm² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm² 2.0km or less in case of CVVS 2.0mm² 24 VDC±10% MAX.3W
Transmission cable Transmission distance Power supply Power consumption	CVVS 1.25 mm² - 4-core or 3-core CVVS 2.0mm² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm² 2.0km or less in case of CVVS 2.0mm² 24 VDC±10% MAX.3W Adapter A <npt1 2=""> or adapter B<npt3 4=""> or</npt3></npt1>
Transmission cable Transmission distance Power supply	CVVS 1.25 mm² - 4-core or 3-core CVVS 2.0mm² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm² 2.0km or less in case of CVVS 2.0mm² 24 VDC±10% MAX.3W Adapter A <npt1 2=""> or adapter B<npt3 4=""> or Pressure proof packing gland <g3 4=""> (Compatible cables \$\phi9.6 - 13.0mm in outer</g3></npt3></npt1>
Transmission cable Transmission distance Power supply Power consumption	CVVS 1.25 mm² - 4-core or 3-core CVVS 2.0mm² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm² 2.0km or less in case of CVVS 2.0mm² 24 VDC±10% MAX.3W Adapter A <npt1 2=""> or adapter B<npt3 4=""> or Pressure proof packing gland <g3 4=""> (Compatible cables \$\phi9.6 - 13.0mm in outer diameter)</g3></npt3></npt1>
Transmission cable Transmission distance Power supply Power consumption	CVVS 1.25 mm² - 4-core or 3-core CVVS 2.0mm² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm² 2.0km or less in case of CVVS 2.0mm² 24 VDC±10% MAX.3W Adapter A <npt1 2=""> or adapter B<npt3 4=""> or Pressure proof packing gland <g3 4=""> (Compatible cables \$\phi9.6 - 13.0mm in outer diameter) Gas inlet: Rc1/4(with BS half union<for cu="" pipe=""> or SUS half union<for pipe="" sus=""></for></for></g3></npt3></npt1>
Transmission cable Transmission distance Power supply Power consumption	CVVS 1.25 mm² - 4-core or 3-core CVVS 2.0mm² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm² 2.0km or less in case of CVVS 2.0mm² 24 VDC±10% MAX.3W Adapter A <npt1 2=""> or adapter B<npt3 4=""> or Pressure proof packing gland <g3 4=""> (Compatible cables \$\phi9.6 - 13.0mm in outer diameter) Gas inlet: Rc1/4(with BS half union<for cu="" pipe=""> or SUS half union<for pipe="" sus=""> for O.D \$\phi6-1t)</for></for></g3></npt3></npt1>
Transmission cable Transmission distance Power supply Power consumption Cabling port	CVVS 1.25 mm² - 4-core or 3-core CVVS 2.0mm² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm² 2.0km or less in case of CVVS 2.0mm² 24 VDC±10% MAX.3W Adapter A <npt1 2=""> or adapter B<npt3 4=""> or Pressure proof packing gland <g3 4=""> (Compatible cables \$\phi9.6 - 13.0mm in outer diameter) Gas inlet: Rc1/4(with BS half union<for cu="" pipe=""> or SUS half union<for pipe="" sus=""> for O.D \$\phi6-1t) Gas outlet: BS union(for Cu pipe) or SUS union(for SUS pipe) for O.D \$\phi8-1t</for></for></g3></npt3></npt1>
Transmission cable Transmission distance Power supply Power consumption Cabling port Piping port	CVVS 1.25 mm² - 4-core or 3-core CVVS 2.0mm² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm² 2.0km or less in case of CVVS 2.0mm² 24 VDC±10% MAX.3W Adapter A <npt1 2=""> or adapter B<npt3 4=""> or Pressure proof packing gland <g3 4=""> (Compatible cables \$\phi 9.6 - 13.0mm in outer diameter) Gas inlet: Rc1/4(with BS half union<for cu="" pipe=""> or SUS half union<for pipe="" sus=""> for O.D \$\phi 6-1t\$) Gas outlet: BS union(for Cu pipe) or SUS union(for SUS pipe) for O.D \$\phi 8-1t\$ Compressed air inlet: BS union(for Cu pipe) for O.D \$\phi 8-1t\$</for></for></g3></npt3></npt1>
Transmission cable Transmission distance Power supply Power consumption Cabling port Piping port Initial clear	CVVS 1.25 mm² - 4-core or 3-core CVVS 2.0mm² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm² 2.0km or less in case of CVVS 2.0mm² 24 VDC±10% MAX.3W Adapter A <npt1 2=""> or adapter B<npt3 4=""> or Pressure proof packing gland <g3 4=""> (Compatible cables \$\phi9.6 - 13.0mm in outer diameter) Gas inlet: Rc1/4(with BS half union<for cu="" pipe=""> or SUS half union<for pipe="" sus=""> for O.D \$\phi6-1t) Gas outlet: BS union(for Cu pipe) or SUS union(for SUS pipe) for O.D \$\phi8-1t Compressed air inlet: BS union(for Cu pipe) for O.D \$\phi8-1t Approx. 25 seconds</for></for></g3></npt3></npt1>
Transmission cable Transmission distance Power supply Power consumption Cabling port Piping port Initial clear Operating	CVVS 1.25 mm² - 4-core or 3-core CVVS 2.0mm² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm² 2.0km or less in case of CVVS 2.0mm² 24 VDC±10% MAX.3W Adapter A <npt1 2=""> or adapter B<npt3 4=""> or Pressure proof packing gland <g3 4=""> (Compatible cables \$\phi 9.6 - 13.0mm in outer diameter) Gas inlet: Rc1/4(with BS half union<for cu="" pipe=""> or SUS half union<for pipe="" sus=""> for O.D \$\phi 6-1t\$) Gas outlet: BS union(for Cu pipe) or SUS union(for SUS pipe) for O.D \$\phi 8-1t\$ Compressed air inlet: BS union(for Cu pipe) for O.D \$\phi 8-1t\$</for></for></g3></npt3></npt1>
Transmission cable Transmission distance Power supply Power consumption Cabling port Piping port Initial clear Operating temperatures	CVVS 1.25 mm² - 4-core or 3-core CVVS 2.0mm² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm² 2.0km or less in case of CVVS 2.0mm² 24 VDC±10% MAX.3W Adapter A <npt1 2=""> or adapter B<npt3 4=""> or Pressure proof packing gland <g3 4=""> (Compatible cables \$\phi 9.6\$ - 13.0mm in outer diameter) Gas inlet:Rc1/4(with BS half union<for cu="" pipe=""> or SUS half union<for pipe="" sus=""> for O.D \$\phi 6-1t\$) Gas outlet:BS union(for Cu pipe) or SUS union(for SUS pipe) for O.D \$\phi 8-1t\$ Compressed air inlet:BS union(for Cu pipe) for O.D \$\phi 8-1t\$ Approx. 25 seconds -20 - +60°C (non-rapidly-vary)</for></for></g3></npt3></npt1>
Transmission cable Transmission distance Power supply Power consumption Cabling port Piping port Initial clear Operating temperatures Operating humidities	CVVS 1.25 mm² - 4-core or 3-core CVVS 2.0mm² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm² 2.0km or less in case of CVVS 2.0mm² 24 VDC±10% MAX.3W Adapter A <npt1 2=""> or adapter B<npt3 4=""> or Pressure proof packing gland <g3 4=""> (Compatible cables \$\phi 9.6\$ - 13.0mm in outer diameter) Gas inlet: Rc1/4(with BS half union<for cu="" pipe=""> or SUS half union<for pipe="" sus=""> for O.D \$\phi 6-1t\$) Gas outlet: BS union(for Cu pipe) or SUS union(for SUS pipe) for O.D \$\phi 8-1t\$ Compressed air inlet: BS union(for Cu pipe) for O.D \$\phi 8-1t\$ Approx. 25 seconds -20 - +60°C (non-rapidly-vary) Below 95% RH (non-condensing)</for></for></g3></npt3></npt1>
Transmission cable Transmission distance Power supply Power consumption Cabling port Piping port Initial clear Operating temperatures Operating humidities Structure	CVVS 1.25 mm² - 4-core or 3-core CVVS 2.0mm² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm² 2.0km or less in case of CVVS 2.0mm² 24 VDC±10% MAX.3W Adapter A <npt1 2=""> or adapter B<npt3 4=""> or Pressure proof packing gland <g3 4=""> (Compatible cables \$\phi 9.6 - 13.0mm in outer diameter) Gas inlet: Rc1/4(with BS half union<for cu="" pipe=""> or SUS half union<for pipe="" sus=""> for O.D \$\phi 6-1t\$) Gas outlet: BS union(for Cu pipe) or SUS union(for SUS pipe) for O.D \$\phi 8-1t\$ Compressed air inlet: BS union(for Cu pipe) for O.D \$\phi 8-1t\$ Approx. 25 seconds -20 - +60°C (non-rapidly-vary) Below 95% RH (non-condensing) Wall mounting sampling unit(Cu Specification or SUS Specification)</for></for></g3></npt3></npt1>
Transmission cable Transmission distance Power supply Power consumption Cabling port Piping port Initial clear Operating temperatures Operating humidities Structure Explosion protected	CVVS 1.25 mm² - 4-core or 3-core CVVS 2.0mm² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm² 2.0km or less in case of CVVS 2.0mm² 24 VDC±10% MAX.3W Adapter A <npt1 2=""> or adapter B<npt3 4=""> or Pressure proof packing gland <g3 4=""> (Compatible cables \$\phi 9.6\$ - 13.0mm in outer diameter) Gas inlet: Rc1/4(with BS half union<for cu="" pipe=""> or SUS half union<for pipe="" sus=""> for O.D \$\phi 6-1t\$) Gas outlet: BS union(for Cu pipe) or SUS union(for SUS pipe) for O.D \$\phi 8-1t\$ Compressed air inlet: BS union(for Cu pipe) for O.D \$\phi 8-1t\$ Approx. 25 seconds -20 - +60°C (non-rapidly-vary) Below 95% RH (non-condensing)</for></for></g3></npt3></npt1>
Transmission cable Transmission distance Power supply Power consumption Cabling port Piping port Initial clear Operating temperatures Operating humidities Structure Explosion protected construction	CVVS 1.25 mm² - 4-core or 3-core CVVS 2.0mm² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm² 2.0km or less in case of CVVS 2.0mm² 24 VDC±10% MAX.3W Adapter A <npt1 2=""> or adapter B<npt3 4=""> or Pressure proof packing gland <g3 4=""> (Compatible cables \$\phi\$.6 - 13.0mm in outer diameter) Gas inlet: Rc1/4(with BS half union<for cu="" pipe=""> or SUS half union<for pipe="" sus=""> for O.D \$\phi6\$-1t) Gas outlet: BS union(for Cu pipe) or SUS union(for SUS pipe) for O.D \$\phi8\$-1t Approx. 25 seconds -20 - +60°C (non-rapidly-vary) Below 95% RH (non-condensing) Wall mounting sampling unit(Cu Specification or SUS Specification) Flame proof structure</for></for></g3></npt3></npt1>
Transmission cable Transmission distance Power supply Power consumption Cabling port Piping port Initial clear Operating temperatures Operating humidities Structure Explosion protected construction Explosion-proof grade	CVVS 1.25 mm² - 4-core or 3-core CVVS 2.0mm² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm² 2.0km or less in case of CVVS 2.0mm² 24 VDC±10% MAX.3W Adapter A <npt1 2=""> or adapter B<npt3 4=""> or Pressure proof packing gland <g3 4=""> (Compatible cables \$\phi 9.6 - 13.0mm in outer diameter) Gas inlet: Rc1/4(with BS half union<for cu="" pipe=""> or SUS half union<for pipe="" sus=""> for O.D \$\phi 6-1t\$) Gas outlet: BS union(for Cu pipe) or SUS union(for SUS pipe) for O.D \$\phi 8-1t\$ Approx. 25 seconds -20 - +60°C (non-rapidly-vary) Below 95% RH (non-condensing) Wall mounting sampling unit(Cu Specification or SUS Specification) Flame proof structure II 2G Ex db II C T5 Gb(ATEX) / Ex db II C T5 Gb(IECEx)</for></for></g3></npt3></npt1>
Transmission cable Transmission distance Power supply Power consumption Cabling port Piping port Initial clear Operating temperatures Operating humidities Structure Explosion protected construction Explosion-proof grade Dimensions	CVVS 1.25 mm² - 4-core or 3-core CVVS 2.0mm² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm² 2.0km or less in case of CVVS 2.0mm² 24 VDC±10% MAX.3W Adapter A <npt1 2=""> or adapter B<npt3 4=""> or Pressure proof packing gland <g3 4=""> (Compatible cables \$\phi 9.6 - 13.0mm in outer diameter) Gas inlet: Rc1/4(with BS half union<for cu="" pipe=""> or SUS half union<for pipe="" sus=""> for O.D \$\phi 6-1t\$) Gas outlet: BS union(for Cu pipe) or SUS union(for SUS pipe) for O.D \$\phi 8-1t\$ Compressed air inlet: BS union(for Cu pipe) for O.D \$\phi 8-1t\$ Approx. 25 seconds -20 - +60°C (non-rapidly-vary) Below 95% RH (non-condensing) Wall mounting sampling unit(Cu Specification or SUS Specification) Flame proof structure II 2G Ex db II C T5 Gb(ATEX) / Ex db II C T5 Gb(IECEx) Approx. 400 (W) x 265 (H) x 102 (D) mm</for></for></g3></npt3></npt1>
Transmission cable Transmission distance Power supply Power consumption Cabling port Piping port Initial clear Operating temperatures Operating humidities Structure Explosion protected construction Explosion-proof grade	CVVS 1.25 mm² - 4-core or 3-core CVVS 2.0mm² - 4-core or 3-core 1.25km or less in case of CVVS 1.25mm² 2.0km or less in case of CVVS 2.0mm² 24 VDC±10% MAX.3W Adapter A <npt1 2=""> or adapter B<npt3 4=""> or Pressure proof packing gland <g3 4=""> (Compatible cables \$\phi 9.6 - 13.0mm in outer diameter) Gas inlet: Rc1/4(with BS half union<for cu="" pipe=""> or SUS half union<for pipe="" sus=""> for O.D \$\phi 6-1t\$) Gas outlet: BS union(for Cu pipe) or SUS union(for SUS pipe) for O.D \$\phi 8-1t\$ Approx. 25 seconds -20 - +60°C (non-rapidly-vary) Below 95% RH (non-condensing) Wall mounting sampling unit(Cu Specification or SUS Specification) Flame proof structure II 2G Ex db II C T5 Gb(ATEX) / Ex db II C T5 Gb(IECEx)</for></for></g3></npt3></npt1>

^{*} When a half-union for gas IN side is changed, check also the external filter (IN/OUT diameter) carefully.

Outline Drawings

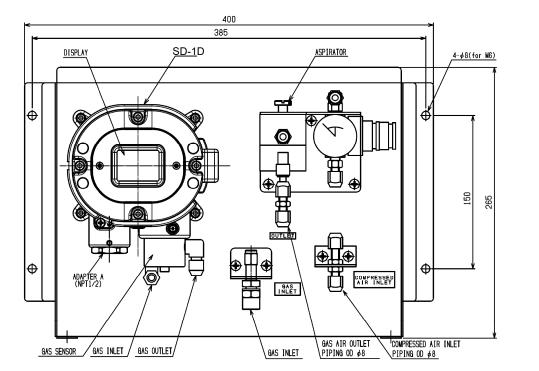

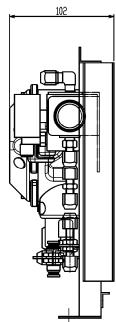

[SD-1D-AS (TYPE GP H)] <TIIS Specifications>

-	H)] <tiis specifications=""></tiis>
Model	SD-1D-AS
Туре	TYPE GP H
Detection principle	Catalytic combustion
Gas to be detected	Combustible gas
Applicable gas	OD 4D (T)(DE OD II)
detector head	SD-1D (TYPE GP H)
Concentration display	LED(4digits • 7segments)
	0 - 100%LEL
Detection range	0.5%LEL
Resolution	
Detection method	Aspirator suction method
Sampling condition	Atmosphere equivalent (Compressed air: 0.1 - 0.7MPa • Consumption Max.
January Sanata	3L/min <atmospheric conversion="">)</atmospheric>
Suction flow	0.8 ±0.1 L/min
Alarm setpoint	25% LEL [standard]
Power display	POWER lamp lighting (green)
Alarm accuracy (under	
the same conditions)	Within ±25% to the alarm setpoint value
Alarm delay time (under	Within 30sec(when introducing 1.6 times thicker gas than alarm setpoint
the same conditions)	value)(without piping delay time)
Gas alarm type	Single alarm(H)
Gas alarm display	ALM lamp lighting(red)
Gas alarm pattern	Auto-recover
Fault alarm/self	Auto-1000vci
	System failure/Sensor failure
diagnosis	TALIL T level lighting/yelleys//equitant display
Fault alarm display	FAULT lamp lighting(yellow)/content display
Fault alarm pattern	Auto-recover
	Two-wire analog transmission + digital transmission(HART communication) or
Transmission system	Three-wire analog transmission(in common with power supply <power< td=""></power<>
	supply,signal,common>)
Transmission	4 - 20 mA DC (linear/load resistance under 300 Ω)
specifications	
Transmission cable	CVVS 1.25 mm ² - 4-core or 3-core
Transmission cable	CVVS 2.0mm ² - 4-core or 3-core
Transmission distance	1.25km or less in case of CVVS 1.25mm ²
Transmission distance	2.0km or less in case of CVVS 2.0mm ²
Power supply	24 VDC±10%
Power consumption	MAX.3W
Cabling port	Pressure proof packing gland <g3 4=""> (Compatible cables ϕ9.6 - 13.0mm in outer</g3>
5	diameter)
Piping port	Gas inlet: Rc1/4(with BS half union <for cu="" pipe=""> or SUS half union<for pipe="" sus=""></for></for>
i ipilig port	for O.D \$\phi 6-1t)
	Gas outlet: BS union(for Cu pipe) or SUS union(for SUS pipe) for O.D ϕ 8-1t
	Compressed air inlet: BS union(for Cu pipe) for O.D ϕ 8-1t
Initial clear	Approx. 25 seconds
Operating	
temperatures	-20 - +53°C (non-rapidly-vary)
Operating humidities	Below 95% RH (Non-condensing)
Structure	Wall mounting sampling unit(Cu Specification or SUS Specification)
Explosion profesied	L Lomo proof of usture
Explosion protected construction	Flame proof structure
construction	·
construction Explosion-proof class	Ex d II C T5 X (TIIS Japan)
construction Explosion-proof class Dimensions	Ex d II C T5 X (TIIS Japan) Approx. 400 (W) x 265 (H) x 102 (D) mm
construction Explosion-proof class	Ex d II C T5 X (TIIS Japan)


^{*} When a half-union for gas IN side is changed, check also the external filter (IN/OUT diameter) carefully.

[SD-1D-AS (TYPE NC H)] <TIIS Specifications>

,	1)] < I IIS Specifications>
Model	SD-1D-AS
Туре	TYPE NC H
Detection principle	New ceramic catalytic method
Gas to be detected	Combustible gas
Applicable gas detector head	SD-1D (TYPE NC H)
Concentration display	LED(4digits • 7segments)
Detection range	Depend on detection gas
Resolution	Depend on detection gas
Detection method	Aspirator suction method
Sampling condition	Atmosphere equivalent (Compressed air: 0.1 - 0.7MPa • Consumption Max. 3L/min <atmospheric conversion="">)</atmospheric>
Suction flow	0.8 ±0.1 L/min
Alarm setpoint	Depend on detection gas
Power display	POWER lamp lighting(green)
Alarm accuracy (under the same conditions)	Within ±25% to the alarm setpoint value
Alarm delay time (under the same conditions)	Within 30sec(when introducing 1.6 times thicker gas than alarm setpoint value)(without piping delay time)
Gas alarm type	Single alarm(H)
Gas alarm display	ALM lamp lighting(red)
Gas alarm pattern	Auto-recover
Fault alarm/self diagnosis	System failure/Sensor failure
Fault alarm display	FAULT lamp lighting(yellow)/content display
Fault alarm pattern	Auto-recover
Transmission system	Two-wire analog transmission + digital transmission(HART communication) or Three-wire analog transmission(in common with power supply <power supply,signal,common="">)</power>
Transmission specifications	4 - 20 mA DC (linear/load resistance under 300 Ω)
Transmission cable	CVVS 1.25 mm ² - 4-core or 3-core CVVS 2.0mm ² - 4-core or 3-core
Transmission distance	1.25km or less in case of CVVS 1.25mm ²
Transmission distance	2.0km or less in case of CVVS 2.0mm ²
Power supply	24 VDC±10%
Power consumption	MAX.3W
Cabling port	Pressure proof packing gland <g3 4=""> (Compatible cables ϕ9.6 - 13.0mm in outer diameter)</g3>
Piping port	Gas inlet: Rc1/4(with BS half union <for cu="" pipe=""> or SUS half union<for pipe="" sus=""> for O.D ϕ6-1t) Gas outlet: BS union(for Cu pipe) or SUS union(for SUS pipe) for O.D ϕ8-1t Compressed air inlet: BS union(for Cu pipe) for O.D ϕ8-1t</for></for>
Initial clear	Approx. 25 seconds
Operating temperatures	-20 - +53°C (non-rapidly-vary)
Operating humidities	Below 95% RH (Non-condensing)
Structure	Wall mounting sampling unit(Cu Specification or SUS Specification)
Explosion protected construction	Flame proof structure
Explosion-proof class	Ex d II C T5 X (TIIS Japan)
Dimensions	Approx. 400 (W) x 265 (H) x 102 (D) mm
Weight	Approx. 5.6kg
Color	Munsell 7.5BG5/2
00101	Midifoli 1.0DOJ/Z

^{*} When a half-union for gas IN side is changed, check also the external filter (IN/OUT diameter) carefully.

Outline Drawings

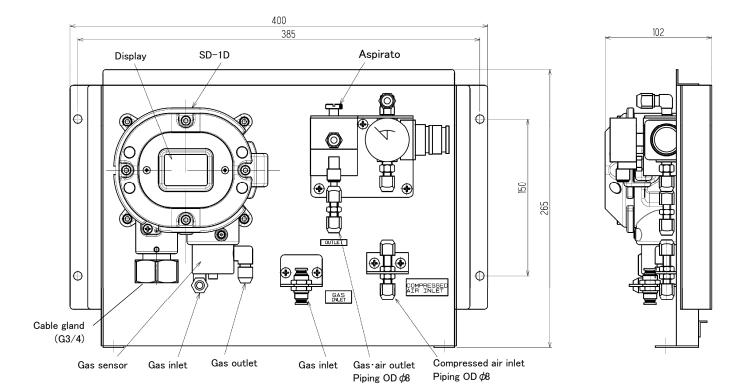


10-2. Detection principle

[Catalytic Combustion Type]

When a combustible gas burns on the surface of a oxidation catalyst, the catalytic combustion type sensor considers resultant combustion heat as temperature and resistance changes in the platinum wire coil, and measures their gas concentrations.

This sensor detects any combustible gases. The detection range is from zero to the lower explosive limit. When a highly-concentrated gas over the lower explosive limit comes into contact with the sensor, it may cause a break.

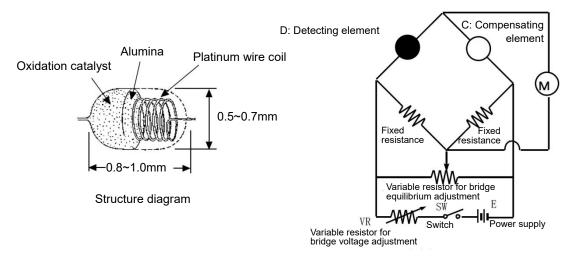


Basic circuit

[New Ceramic Type]

When a combustible gas burns on the surface of a highly active new ceramic oxidation catalyst in catalytic combustion, the new ceramic-type sensor measures resultant temperature changes by measuring the resistance changes in the heat-resistant alloy wire coil.

The sensor consists of two elements: A detecting element having a heat-resistant alloy wire coil with an ultrafine particle (new ceramic) oxidation catalyst sintered on it together with a carrier and a temperature-compensating element with a mixture of gas-inert alumina and glass sintered on it. When a combustible gas comes into contact with the surface of the detecting element with new ceramic oxidation catalyst sintered on it, the gas burns, causing the temperature to rise. In accordance with this temperature change, there occurs a change in the resistance of a heat-resistant alloy wire coil that constitutes the element. These resistance values are approximately proportional to gas concentrations. From the changes in the resistance values, potential differences are obtained using a bridge circuit and displayed as gas concentrations on the meter.

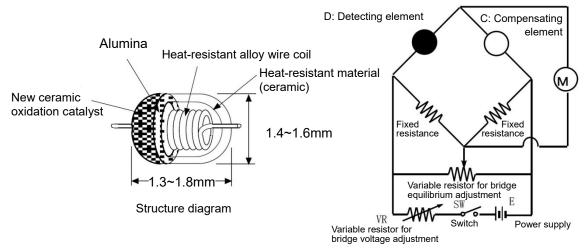

Basic circuit

11

Definition of Terms

Catalytic combustion type	This is a principle of the sensor installed in the TYPE GP H. See "10-2. Detection principle" for details.
New ceramic	This is a principle of the sensor installed in the TYPE NC H. See "10-2. Detection principle" for details.
Initial clear	Output from the detector head fluctuates for a while after turning on the power. This is a function to prevent triggering alarm during that time.
Full scale	Maximum value of the detection range.
%LEL	A unit which the lower explosive limit (LEL) of the combustible gas to be detected is set to 100.
ppm	A concentration unit that means part per million of the combustible gas to be detected.
Calibration	Adjusts the readings to the calibration gas concentration value by using the calibration gas.
Zero suppression	A function to cut off the specific drifting that the sensor has.
Alarm delay time	A function which temporarily suspends activation to prevent a false alarm caused by noise from its outside.
INHIBIT	The gas detection function is temporarily suspended during maintenance etc. of the detector. This is also called "point skip", which has the same function.
HART communication	DC4-20mA signal digitals signalling is superimposed, and is methods that transmit multiple signals.

Revision History

Issue	Revision details	Issue date
0	First issue	10/4/2019
1	Declaration of Conformity	12/23/2019
2	Declaration of Conformity	4/1/2020
3	Safety information, Declaration of Conformity	8/1/2020
4	Safety information, Declaration of Conformity	8/21/2020
5	Declaration of Conformity	11/12/2021



EU-Declaration of Conformity

Document No.: 320CE21104



We, RIKEN KEIKI Co., Ltd. 2-7-6, Azusawa, Itabashi-ku, Tokyo, 174-8744 Japan declare under our sole responsibility that the following product conforms to all the relevant provisions.

Product Name: Smart Transmitter/Gas Detector Head

Model: SD-1, SD-1D, SD-1GH, SD-1DGH

Cou	uncil Directives	Applicable Standards	
2014/30/EU	EMC Directive	EN 50270:2015	
2014/34/EU	ATEX Directive	EN IEC 60079-0:2018 EN 60079-1:2014	
2011/65/EU	RoHS Directive	EN IEC 63000:2018	

EU-Type examination Certificate No.

KEMA 10ATEX0083 X

Notified Body for ATEX

DEKRA Certification B.V. (NB 0344) Meander 1051,6825 MJ Arnhem P.O.Box5185,6802 ED Arnhem

The Netherlands

Auditing Organization for ATEX

DNV Product Assurance AS (NB 2460)

Veritasveien 3 1363 Høvik Norway

The marking of the product shall include the following:

 $\langle \varepsilon_{x} \rangle$

II 2 G Ex db IIC T5 Gb

Place: Tokyo, Japan

Date: Sep. 22, 2021

Takakura Toshiyuki General manager

Quality Control Center

I. Lelpsien